

QUARTERLY OPERATIONS REPORT


DISTRICT OF COLUMBIA

COMBINED SEWER OVERFLOW FACILITIES

THIRD QUARTER, 2026

Prepared By:

D.C. Water and Sewer Authority
Department of Pumping and Sewer Operations
3101 Ames Place, NE
Washington, D.C. 20032

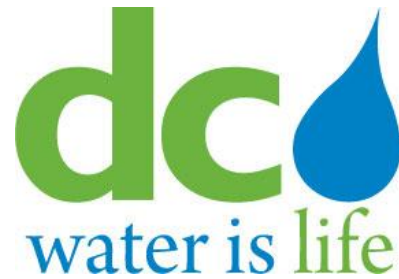

**DISTRICT OF COLUMBIA
WATER AND SEWER AUTHORITY**
Serving the Public • Protecting the Environment

**Monthly Operations Report For
*Combined Sewer System***

Month: July 2026

Prepared By:
District of Columbia
Water and Sewer Authority
Department of
Pumping and Sewer Operations
Washington, D.C. 20003

DISTRICT OF COLUMBIA
WATER AND SEWER AUTHORITY
Washington, D.C.

Monthly Operations Report for Combined Sewer System
Month: July 2026
Table of Contents

- 1. INTRODUCTION**
- 2. OPERATION AND MAINTENANCE**
 - 2.1 Regulators
 - 2.2 Outfalls, Tide Gates and CSO Signs
 - 2.3 Pumping Stations
 - 2.4 Inflatable Dams and SCADA Systems
- 3. DRY WEATHER OVERFLOWS**
- 4. SOLIDS AND FLOATABLES CONTROL**
 - 4.1 Catch Basin Cleaning
 - 4.2 BMP Demonstration for Solid and Floatable Control
 - 4.3 Anacostia River Floating Debris Removal Program
 - 4.4 CSS Litter Control
- 5. MONITORING**
 - 5.1 Bar Racks at Main & O Street
 - 5.2 Rainfall Data
 - 5.3 Wet Weather Overflows

1. INTRODUCTION

The District of Columbia Water and Sewer Authority (DC Water) operates a wastewater collection system comprised of separate and combined sewers. Separate storm and sanitary sewers serve two-thirds of the District. In the combined sewer system (CSS), there is a single sewer to convey storm water and sanitary wastes. The area served by combined sewers comprises about one-third of the District.

During dry weather, sanitary wastes collected in the CSS are conveyed to the DC Water's advanced wastewater treatment plant at Blue Plains (BPAWWTP or the Blue Plains AWWTP). During periods of rainfall, the capacity of a combined sewer may be exceeded and the excess flow, which is a mixture of storm water and sanitary wastes, is discharged directly to the Anacostia River, Rock Creek or the Potomac River or their tributary waters. This report summarizes the operations of the combined sewer system for the month indicated.

2. OPERATION AND MAINTENANCE

2.1 Regulators

Regulators divert combined sewage to interceptors, which convey flow to BPAWWTP for treatment. When flows exceed the capacities of the systems such as during significant rain events, regulators divert excess flow to the tunnel system for temporary storage, and CSO outfalls which discharge to receiving waters. The following table summarizes inspections of CSO regulators in the collection system.

Table 2-1
Regulator Structures

Structure Number	Location	Associated NPDES Outfall	Date Inspected	Condition		Work Needed	Work performed
				Good	Needs Work		
2 ¹	Bolling AFB, 2250 ft. north of the south line of the Base, SW	003	N/A				
4 ¹	Bolling AFB, 2250 ft. north of the south line of the Base, SW	003	N/A				
5 ¹	Poplar Point Pumping Station	004	N/A				
6	Chicago Street and Railroad Ave, SE	005	07/20/2026	*			
7	W Street and Railroad Ave, SE	005	07/13/2026	*			
8 ¹	Good Hope Rd, west of Nichols Ave, SE	006	N/A				
9	13 th Street and Ridge Place, SE (Diversion Structure)	007	07/13/2026	*			
9a	13 th Street and Ridge Place, SE (Regulator Structure)	007	07/13/2026	*			
9b	11 th Street Bridge and DC 295 SB (CSO-007 Diversion Chamber)	007	07/29/2026	*			
11	"O" Street Pumping Station	011(a)	07/09/2026	*			
12	Storm Pump Discharge at Main Pumping Station	011	07/09/2026	*			
13	2 nd Street, 300 ft. north of N Place, SE	009	07/13/2026	*			
14	2 nd Street, 250 ft. north of N Place, SE	011(a)	07/28/2026	*			
15	South Capitol and E Streets	010	07/16/2026	*			
15a	Half and L Streets, SE	010	07/16/2026	*			
15b	South Capitol and I Streets	010	07/13/2026	*			
15c	South Capitol and I Streets	010	07/14/2026	*			

Structure Number	Location	Associated NPDES Outfall	Date Inspected	Condition		Work Needed	Work performed
				Good	Needs Work		
16	North of Main Sewage Pumping Station	012	07/28/2026	*			
17	4 th and N Streets, SE, Both Extended	013	07/15/2026	*			
17a	K Street between 6 th Street and 7 th Street, SE (Side Overflow Weir)	013	07/15/2026	*			
17b	4 th and N Streets, SE, Both Extended (CSO-013 Diversion Chamber)	013	07/30/2026	*			
18	6 th and M Streets, SE (Diversion and Overflow Structure)	014	07/15/2026	*			
18a	Tingey Street SE and 5 1 / 2 Street SE (CSO-014 Diversion Chamber)	014	07/15/2026	*			
19	9 th and M Streets, SE	015	07/15/2026	*			
19a	9 th and M Streets, SE	015	07/15/2026	*			
19b	9 th and M Streets, SE (Diversion Chamber)	015	07/15/2026	*			
19c	9 th and M Streets, SE (Diversion Chamber)	015	07/15/2026	*			
20	12 th and M Streets, SE	016	07/15/2026	*			
20a	12 th and M Streets, SE	016	07/15/2026	*			
20b	12 th and M Streets, SE (CSO-016 Diversion Chamber)	016	07/15/2026	*			
21	14 th and M Streets, SE	017	07/15/2026	*			
21a	14 th and M Streets, SE (CSO-017 Diversion Chamber)	017	07/15/2026	*			
22a	Barney Circle and Pennsylvania Ave, SE	018	07/23/2026	*			
22b	Barney Circle and Pennsylvania Ave, SE	018	07/23/2026	*			
22c	Barney Circle and Pennsylvania Ave, SE	018	07/23/2026	*			
22d	Kentucky Ave and Potomac Street, SE	018	07/23/2026	*			
22e	14 th Street and Kentucky Ave, SE	018	07/23/2026	*			
23	Independence Ave, 21 st Street, SE, Extended	019	07/23/2026	*			
24a	East Capitol St, west of RFK stadium	019	07/23/2026	*			
28	21 st and Constitution Ave, NW	020	07/07/2026	*			
29	22 nd Street, between Constitution Ave and C St, NW	020	07/07/2026	*			
30	17 th and D Streets, NW	020	07/07/2026	*			
31	15 th Street and Pennsylvania Ave, NW	020	07/07/2026	*			
33	10 th and F Streets, NW	020	07/07/2026	*			
34	23 rd Street, north of Constitution Ave, NW	020	07/16/2026	*			
34a	23 rd Street near C Street, NW	020	07/07/2026	*			
35	Northeast of Roosevelt Bridge, NW	021	07/28/2026	*			
35c	Kennedy Center Rock Creek and Potomac Pkwy Northeast of Roosevelt Bridge, NW	021	07/28/2026	*			
36	27 th and I Streets, NW	022	07/07/2026	*			
36a	New Hampshire Ave and Eye Street, NW	022	07/07/2026	*			

Structure Number	Location	Associated NPDES Outfall	Date Inspected	Condition		Work Needed	Work performed
				Good	Needs Work		
36b	19 th and L Streets, NW	022, 034	07/08/2026	*			
36d	17 th and L Streets, NW	022, 034	07/08/2026	*			
36g	18 th and M Streets, NW	022, 034	07/08/2026	*			
36h	18 th and M Streets, NW	022, 034	07/08/2026	*			
37	27 th and Eye Streets, NW	022	07/07/2026	*			
38	29 th and K Streets, NW	024	07/07/2026	*			
38a	30 th Street, south of K Street, NW	024	07/07/2026	*			
39a	30 th and K Streets, NW	024	07/07/2026	*			
39b	30 th and K Streets, NW	024	07/07/2026	*			
41b ¹	31 st and K Streets, NW	025	N/A				
41c ¹	31 st and K Streets, NW	025	N/A				
42 ¹	Wisconsin Ave and K Street, NW	026	N/A				
43	Potomac and Water Streets, NW	027	07/07/2026	*			
43a	Potomac and Water Streets, NW	027	07/07/2026	*			
44	Water Street, west of Potomac St, NW	027	07/07/2026	*			
45	36 th and M Streets, NW	028	07/08/2026	*			
46	Canal Rd, 1000ft. east of Foxhall Rd, NW	029	07/08/2026	*			
47	38 th Street and Reservoir Road, NW	029	07/08/2026	*			
47a	37 th and T Streets, NW	029	07/08/2026	*			
47b	37 th and T Streets, NW	029	07/08/2026	*			
47c	38 th and W Streets, NW	029	07/08/2026	*			
49 ¹	Pennsylvania Ave, east side of Rock Creek, NW	031	N/A				
50	26 and M Streets, NW	032	07/27/2026	*			
51	N Street Extended, west of 25 th Street, NW	033	07/27/2026	*			
52	22 nd Street between M and N Streets, NW	034	07/28/2026	*			
52a	N Street between 22 nd and 23 rd Streets, NW	034	07/08/2026	*			
53	22 nd and M Streets, NW	022, 034	07/08/2026	*			
53a	22 nd and M Streets, NW	022, 034	07/08/2026	*			
53b	L Street between 21 st Street and New Hampshire Ave, NW	022, 034	07/08/2026	*			
53c	L and 22 nd Streets, NW	022	07/08/2026	*			
54	23 rd and O Streets, NW	034	07/20/2026	*			
55	22 nd Street, south of Q Street, NW	035	07/20/2026	*			
55a	22 nd Street, south of Q Street, NW	035	07/20/2026	*			

Structure Number	Location	Associated NPDES Outfall	Date Inspected	Condition		Work Needed	Work performed
				Good	Needs Work		
56	23 rd and Massachusetts Ave, NW	036	07/20/2026	*			
57	23 rd Street, south of Q Street, NW	036	07/20/2026	*			
58 ¹	Northwest of Belmont Road and Rock Creek and Potomac Parkway, NW	037	N/A				
59	North of Belmont Rd, east of Kalorama Cir, NW	038	07/21/2026	*			
60	Connecticut Ave, east of Rock Creek, NW	039	07/21/2026	*			
61	Biltmore St, Extended, east of Rock Creek, NW	040	07/21/2026	*			
62	Ontario Rd, Extended, and Rock Creek Pkwy, NW	041	07/21/2026	*			
63	Harvard Street and Rock Creek Parkway, NW	042	07/21/2026	*			
64	Adams Mill Road, south of Irving Street, NW	043	07/27/2026	*			
65	Kenyon Street and Adams Mill Road, NW	044	07/21/2026	*			
65a	Kenyon Street and Adams Mill Road, NW	044	07/21/2026	*			
66	Adams Mill Road and Lamont Street, NW	045	07/21/2026	*			
67	Park Rd , south of Piney Branch Pkwy, NW	046	07/21/2026	*			
68	Ingleside Terrance, Extended and Piney Branch Parkway, NW	047	07/27/2026	*			
69	Mt. Pleasant Street, Extended and Piney Branch Parkway, NW	048	07/27/2026	*			
70	Piney Branch Parkway, west of 16 th Street, NW	049	07/27/2026	*			
70i	5 th and Quackenbos Streets, NW	049	07/27/2026	*			
71	28 th Street, west of Rock Creek Parkway, NW	050	07/20/2026	*			
72	Olive Street Extended and Rock Creek Pkwy, NW	051	07/20/2026	*			
72a	Olive Street Extended and Rock Creek Pkwy, NW	051	07/20/2026	*			
73	O Street Extended and Rock Creek Parkway, NW	052	07/30/2026	*			
74 ¹	Q Street, west of Rock Creek, NW	053	N/A				
75	West side of Rock Creek, 300 ft. south of Massachusetts Ave, NW	054	07/21/2026	*			
77	Normanstone Dr Extended, west of Rock Creek, NW	056	07/21/2026	*			
77a	Normanstone Dr and Normanstone Lane, NW	056	07/21/2026	*			
78 ¹	28th Street Extended, west of Rock Creek, NW	057	N/A				
79 ¹	Connecticut Ave and Rock Creek Parkway, NW	058	N/A				
84	26 th and P Streets, NW	060	07/20/2026	*			
84a	26 th and P Streets, NW	060	07/20/2026	*			
86	Diversion Chamber and Vortex Drop at First and Channing St, NW (First St Tunnel)	019	07/22/2026	*			
88	Flagler and Adams St. NW (First St Tunnel)	019	07/22/2026	*			
89	First and V St, NW (First St Tunnel)	019	07/22/2026	*			

Structure Number	Location	Associated NPDES Outfall	Date Inspected	Condition		Work Needed	Work performed
				Good	Needs Work		
90	First and V St, NW (First St Tunnel)	019	07/22/2026	*			
91	First and V St, NW (First St Tunnel)	019	07/22/2026	*			
92	CSO 019 Diversion Near Eastside PS (Anacostia River Tunnel)	019	07/29/2026	*			
93	CSO 018 Diversion Near Barney Circle (Anacostia River Tunnel)	018	07/29/2026	*			
95	M Street Approach Channel M and Water St SE (Anacostia River Tunnel)	015, 016, 017	07/15/2026	*			
96	CSO 007 Shaft at 11 th St Bridge and DC I-295 SB Diversion Facilities (Anacostia River Tunnel)	007	07/23/2026	*			
97	CSO 005 Diversion at Chicago St Trunk Sewer, I295 SB (Anacostia River Tunnel)	005	07/23/2026	*			
98	Main Pumping Station Diversions (Anacostia River Tunnel)	009 – 012	07/29/2026	*			
99	CSO 009 and 011a Diversion Facilities (Anacostia River Tunnel)	009, 011a	07/28/2026	*			
100	CSO 012 Diversion Facilities (Anacostia River Tunnel)	012	07/28/2026	*			
101	Main Outfall Sewer Diversion Chamber (Anacostia River Tunnel)	N/A	07/14/2026	*			
102	Anacostia Main Interceptor Diversion Chamber	N/A	07/14/2026	*			
103	Poplar Point PS Emergency Overflow Chamber (Anacostia River Tunnel)	N/A	07/14/2026	*			
104	Poplar Point PS Discharge Chamber	N/A	07/14/2026	*			
105	Potomac Outfall Sewer Diversion Chamber (Anacostia River Tunnel)	003A	07/23/2026	*			
106	R Street Diversion Chamber (RS-DC) and R Street Drop Shaft (RS-DS)	019	07/22/2026	*			
107	Florida Avenue Diversion Chamber (FLA-DC), Florida Avenue Drop Shaft (FLA-DS)	019	07/22/2026	*			
108	T Street Junction Chamber (TS-JC), T Street Drop Shaft (TS-DS)	019	07/22/2026	*			
109	4th Street NE Diversion Chamber (4S-DC), 4th Street Drop Shaft (4S-DS)	019	07/22/2026	*			
110	Rhode Island Avenue Diversion Chamber (RIA-DC), Rhode Island Avenue Drop Shaft (RIA-DS)	019	07/22/2026	*			
111a	Mount Olivet Road Junction Chamber (MOR-JC)	019	07/22/2026	*			
111b	Mount Olivet Road Diversion Chamber (MOR-DC)	019	07/22/2026	*			
111c	Mount Olivet Road Drop Shaft (MOR-DS)	019	07/22/2026	*			

Notes:

1. Noted structures no longer function as a combined sewer overflow regulator structure.

2.2 Outfalls, Tide Gates and CSO Signs

The following table summarizes inspections, maintenance and work performed on outfall structures, tide gates and CSO signs in the collection system.

Table 2-2
Outfalls and Tide Gates

NPDES Outfall	Location	Date Inspected	Outfall Condition		Tide Gate Present?		Tide Gate Condition		CSO Sign		Notes, Work Needed or Performed
			OK	Needs Work	Yes	No	OK	Needs Work	OK	Needs Work	
003 ¹	Bolling Air Force Base, at Giavanolli and Chanute, SW	N/A									
003a	Joint Base Anacostia Bolling Macdill and Arnold Ave SW	07/23/2026	*		*		*		*		
005	Across from Navy Yard, aligned with Parsons Ave., SE	07/13/2026	*		*		*		*		
006 ¹	Good Hope Road and Welsh Memorial Bridge	N/A									
007	Between 11 th St. and Anacostia Bridges, SE	07/13/2026	*		*		*		*		
009	O St. Sewage Pumping Station, SE	07/09/2026	*		*		*		*		
010	O St. Sewage Pumping Station, SE	07/09/2026	*			*			*		
011	Main Sewage Pumping Station, SE	07/09/2026	*			*			*		
011a	Main Sewage Pumping Station, SE	07/09/2026	*		*		*		*		
012	Main Sewage Pumping Station, SE	07/09/2026	*		*		*		*		
013	Southeast Federal Center, aligned with 4 th St.	07/09/2026	*		*		*		*		
014	Navy Yard, aligned with 6 th St., SE	07/09/2026	*		*		*		*		
015	Navy Yard, aligned with 9th Street, SE	07/09/2026	*			*			*		
016	12th and O Streets, SE	07/09/2026	*		*		*		*		
017	M and Water Street, SE	07/09/2026	*		*		*		*		
018	East of Barney Circle & South of Pennsylvania Avenue Bridge, SE	07/09/2026	*		*		*		*		
019	Adjacent to Service Drive behind swirl facility & D.C. General Hospital	07/29/2026	*		*		*		*		
019a	Adjacent to Service Drive behind swirl facility & D.C. General Hospital (Tunnel Overflow Structure)	07/29/2026	*		*		*		*		
020	Rock Creek Parkway and Independence, NW	07/14/2026	*		*		*		*		
021	Rock Creek Parkway and C St., NW	07/14/2026	*		*		*		*		
022	Rock Creek Parkway and G St., NW	07/14/2026	*		*		*		*		
024	South of 30 th and K Streets, NW	07/07/2026	*		*		*		*		
025 ¹	South of 31st and K Streets, NW	N/A									
026 ¹	Wisconsin Avenue and Water Street, NW	N/A									
027	33 rd and Water Sts., NW	07/07/2026	*			*			*		
028	Key Bridge and Whitehurst Freeway, NW	07/14/2026	*			*			*		
029	Adjacent to C&O Canal, aligned with 38 th St. NW	07/14/2026	*			*			*		

NPDES Outfall	Location	Date Inspected	Outfall Condition		Tide Gate Present?		Tide Gate Condition		CSO Sign		Notes, Work Needed or Performed
			OK	Needs Work	Yes	No	OK	Needs Work	OK	Needs Work	
031 ¹	Rock Creek Pkwy & Pennsylvania Avenue, NW	N/A									
032	26th and M Street, NW	07/27/2026	*			*			*		
033	Across street from St. Francis Jr. High and aligned with N St., NW.	07/27/2026	*		*		*		*		
034	Just west of St. Francis Jr. High and north of N St., NW	07/20/2026	*			*			*		
035	P St. Bridge and Rock Creek Parkway	07/20/2026	*			*			*		
036	22nd Street, South of Q Street NW.	07/20/2026	*		*		*		*		
037 ¹	Waterside Dr. and Rock Creek Parkway	N/A									
038	Between arch footbridge and Connecticut Ave., north of Kalorama Circle, NW.	07/21/2026	*		*		*		*		
039	Connecticut Avenue Bridge and Rock Creek Parkway, NW.	07/21/2026	*		*		*		*		
040	Aligned with Biltmore Rd., between Connecticut Ave and Ellington Bridge.	07/21/2026	*		*		*		*		
041	Beach Dr. and Ontario Pl., NW	07/20/2026	*		*		*		*		
042	Harvard St. and Beach Dr NW.	07/20/2026	*		*		*		*		
043	Upstream of Harvard St. and Beach Dr NW.	07/20/2026	*		*		*		*		
044	Kenyon Street and Beach Dr., NW.	07/20/2026	*		*		*		*		
045	North of Beach Dr. and Walbridge Pl, NW.	07/20/2026	*		*		*		*		
046	Piney Branch Parkway and Park Road, NW.	07/27/2026	*			*			*		
047	Piney Branch Parkway and Ingleside Terrace	07/27/2026	*		*		*		*		
048	South of Piney Branch Parkway and 17 th St.	07/27/2026	*		*		*		*		
049	North of Piney Branch Parkway and 17 th St.	07/27/2026	*		*		*		*		
050	Rock Creek Parkway and L St., NW	07/20/2026	*		*		*		*		
051	Across Rock Creek Pkwy, aligned with Olive St., NW.	07/30/2026	*		*		*		*		
052	Between P & Penna. Ave Bridges, aligned with O Street, NW.	07/30/2026	*		*		*		*		
053 ¹	Q St. Bridge and Rock Creek Parkway, NW.	N/A									
054	Massachusetts Ave & Rock Creek Parkway, NW.	07/21/2026	*		*		*		*		
056	Normanstone Dr. and Rock Creek Parkway, NW.	07/21/2026	*		*		*		*		
057 ¹	28th Street and Rock Creek Parkway, NW	N/A									
058 ¹	Connecticut Ave & Rock Creek Parkway, NW.	N/A									
060	North of P St. Bridge & Rock Creek Pkwy, NW	07/20/2026	*		*		*		*		

Notes:

1. Outfall no longer functions as a combined sewer outfall.

Pumping Stations

Pumping station operations are summarized in the table below.

Table 2-3
Pumping Stations – Inspections and Equipment in Service

<i>Pumping Station</i>	<i>No. of Inspections</i>	<i>No. Screens</i>	<i>No. Pumps</i>	<i>Screens or Pumps Out of Service</i>	<i>Dates</i>	<i>Reason</i>	<i>Work Order Number</i>	<i>Schedule to Restore to Service</i>
Main	31	3	4	Screen 4	07/01/26-07/31/26	Screen motor failure	26-572714	Anticipated return to service 9/30/26
				Pump 3	07/01/26-07/10/26	John Crane valve replacement	26-470813	Returned to service 7/10/26
O Street	31	2	4	Screen 2	07/01/26-07/31/26	High motor alarm	26-29851	Anticipated return to service 09/30/26
				Pump 4 ²	07/01/26-07/31/26	Actuator needs to be replaced	26-120944	Anticipated return to service 10/31/26
Eastside	1	2	4	Pump 4	07/01/26-07/31/26	Suction and discharge issue	26-368268	Anticipated return to service 08/14/26
Poplar Point	1	2	4	None	-	-	-	-
Potomac	31	4	5	Pump 1 ¹	07/01/26-07/31/26	Motor needs repair	25-579179	Anticipated return to service 02/28/27
				Pump 5	07/01/26-07/31/26	Motor Overload	26-425688	Anticipated return to service 8/30/26

Notes:

1. Manufacturer parts aren't readily available, so we continue to wait for replacement parts to be built and delivered. Upgrade CIP project underway to replace with new equipment.
2. Contractors working underground, actuator will be replaced once work is completed

Table 2-4
Pumping Stations – Preventive Maintenance

<i>Pumping Station</i>	<i>Date Performed</i>	<i>Type of Preventive Maintenance Performed¹</i>	<i>Work Order Number</i>	<i>Comments</i>
Main	07/03/26	Group A	26-612058	Add oil, grease bearings and replace packing if needed.
O St	07/03/26	Group A	26-627524	Add oil, grease bearings and replace packing if needed.
Eastside	07/14/26	Group A	26-574539	Add oil, grease bearings and replace packing if needed.
Poplar Point	07/14/26	Group A	26-615540	Add oil, grease bearings and replace packing if needed.
Potomac	07/03/26	Group A	26-628375	Add oil, grease bearings and replace packing if needed.
Rock Creek	07/14/26	Group A	26-553421	Add oil, grease bearings and replace packing if needed.
Upper Anacostia	07/14/26	Group A	26-615912	Add oil, grease bearings and replace packing if needed.
Earl Place	07/14/26	Group A	26-588165	Add oil, grease bearings and replace packing if needed.

Notes:

1. Group A consists of:
 - a. Exercise bar screens
 - b. Exercise all sump pumps
 - c. Drain condensation from air compressor storage tank
 - d. Check depth of screening in the screen room and schedule Vactor truck as required
 - e. Check all safety equipment
 - f. Issue work order requests as required

Table 2-5
Pumping Stations – Pumpage

	<i>Sanitary Pumpage</i>		<i>Screenings Collected (tons)¹</i>
<i>Pumping Station</i>	<i>Total Wastewater (mg)</i>	<i>Daily Average Wastewater (mg)</i>	
Main ^{1,2}	1184.97	39.5	N/A
O St ^{1,2}	160.87	5.19	N/A
Eastside	98.21	3.17	N/A
Poplar Point	272.54	8.79	N/A
Potomac	3119.58	100.63	N/A
Rock Creek ³	26.36**	0.85**	N/A
Upper Anacostia	30.53	0.98	N/A
Earl Place	0.6448	0.0208	N/A

Notes:

1. Screenings collected from the Main and O Street Pumping Stations are combined from the sanitary flow and combined sewer overflows, due to the design of the screening system that consists of vertical trash racks, with no mechanical cleaning. Therefore, quantification of captured screening materials, specifically from combined sewer overflows, is not feasible.
2. Flow meters have been installed in accordance with NPDES Permit No. DC002199 to record CSO discharges from Main and O Street Pumping Stations. This data is reported via Discharge Monitoring Reports submitted to the EPA on a monthly basis. A summary of metered and modeled CSO discharges is included in Section 5.
3. In April 2025, instrumentation began work to replace the flow meter on Pump #2 at Rock Creek PS. Replacement will occur once the flow meter supplier is able to send out new equipment. See WO# 25-385565 **Values above are directly from SCADA software

2.3 Inflatable Dams and SCADA System

DC Water operates and maintains nine inflatable dams at seven different locations. Table 2-6 summarizes the date(s) the inflatable dams were inspected, and their operational status and condition. The inflatable dams consist of multi-ply elastomeric (i.e., “rubber”) fabric dams installed in major overflow conduits within the combined sewer system. The objective of the inflatable dam installation is to increase the effective depth to which the sewage must rise in the combined sewer before overflows occur. The effect of the installation is to retain a greater volume of combined sewage flow resulting from low to moderate intensity storms by maximizing storage within the CSS. During higher intensity storms, when the full carrying capacity of the overflow conduit is required to prevent upstream flooding, the dam is deflated automatically. Inflatable dam operations are summarized below:

Table 2-6
Inflatable Dams – Inspections and Equipment in Service

<i>Inflatable Dam Structure No</i>	<i>Date Inspected</i>	<i>Was Dam Out of Service During the Month?</i>	<i>Dates out of Service</i>	<i>Reason</i>	<i>Schedule to Restore to Service</i>
14 – East	7/28/26	No	N/A	N/A	N/A
14 – West	7/28/26	No	N/A	N/A	N/A
15	7/16/26	No	N/A	N/A	N/A
15A	7/16/26	No	N/A	N/A	N/A
16 – East	7/28/26	No	N/A	N/A	N/A
16 – West	7/28/26	No	N/A	N/A	N/A
34	7/16/26	No	N/A	N/A	N/A
35	7/12/16	Yes	7/12/26	Note 1	7/12/26
	7/28/26	No	N/A	N/A	N/A
52	7/28/26	No	N/A	N/A	N/A

Notes:

1. Structure 35 deflated on 7/12/26 around 6:14am due to a loss of power. Instrumentation was notified and the structure was reinflated and returned to service within one hour. This was not an overflow to the river as the upstream levels were lower than the low-level threshold.

Table 2-7
Inflatable Dams & SCADA Sites – Wet Weather Operations

<i>Inflatable Dam Structure No.</i>	<i>Overflow Dates</i>	<i>Estimated Duration of Overflow</i>	<i>Inflatable Dam Operational Status</i>
14 (E & W)	<i>None</i>	<i>N/A</i>	<i>Inflated</i>
15	<i>None</i>	<i>N/A</i>	<i>Inflated</i>
15A	<i>None</i>	<i>N/A</i>	<i>Inflated</i>
16 (E & W)	<i>None</i>	<i>N/A</i>	<i>Inflated</i>
34	<i>None</i>	<i>N/A</i>	<i>Inflated</i>
35	07/09/2026 07/28/2026	16mins 43mins	Deflated Deflated
52	<i>None</i>	<i>N/A</i>	<i>Inflated</i>
<i>Structures on Outfall Sewers</i>	<i>Overflow Dates</i>	<i>Estimated Duration of Overflow</i>	<i>N/A</i>
Outfall Structure 1	None	This structure has been bulk headed. Overflows are no longer possible.	
Outfall Structure 1A	None	This structure has been bulk headed. Overflows are no longer possible.	
Outfall Structure 2	None	N/A	
<i>Outfall Sewer Control Gates</i>	<i>Operational Status</i>	<i>Position</i>	
Outfall Sewer Control Gate No.1	Operational	Open	
Outfall Sewer Control Gate No.2	Operational	This structure has been bulk headed. Overflows are no longer possible	
Outfall Sewer Control Gate No.2	Operational	This structure has been bulk headed. Overflows are no longer possible	

Notes:

3. DRY WEATHER OVERFLOWS

There was no dry weather combined sewer overflow reported during July 2026.

4. SOLIDS AND FLOATABLES CONTROL

4.1 Catch Basin Cleaning

The following tables summarize catch basin cleaning in the Anacostia CSO area and in the entire sewer system:

**Table 4-1
Catch Basin Cleaning**

Ward	Total CBs	CBs in CSS	Inspections			Cleaning					
			CBs in Anacostia CSS	Total Anacostia CBs Inspected Once this Year	Total Anacostia CBs Inspected Twice this Year	CBs Cleaned Thru Last Month		CB's Cleaned This Month		Total CBs Cleaned This Year to Date	
						Total	In CSS	Total	In CSS	Total	In CSS
1	1467	1442	655	473	28	133	116	180	180	313	296
2	2832	2647	486	312	32	233	127	78	76	311	203
3	3720	183	0	0	0	3453	5	26	13	3479	18
4	3521	1729	0	0	0	1795	127	1445	1439	3240	1566
5	4066	1758	1693	1094	77	2345	102	76	28	2421	130
6	3333	2692	2676	1936	126	726	87	96	92	822	179
7	3879	43	43	41	0	3548	3	51	0	3599	3
8	2930	213	212	7	0	1771	4	32	3	1803	7
Grand Total	25748¹	10707¹	5765¹	3863	263	14004	571	1984	1831	15988	2402
% Cleaned/Inspected to Date				67%	5%					62%	22%

Notes:

1. The number of catch basins in our service area changes with the ongoing connections and abandonments to the sewer infrastructure.

4.2 BMP Demonstration for Solid and Floatable Control

DC WATER operates the following demonstration projects designed to remove solids and floatables from CSO prior to discharge.

- Bar Rack at CSO 040 and 041 to Rock Creek

Table 4-2
BMP Demonstration Projects – Report

<i>Facility</i>	<i>Date Inspected</i>	<i>Condition</i>	<i>Work Needed</i>	<i>Work performed</i>	<i>Material Removed (LB)</i>
Bar Rack CSO 040	7/21/2026	Good	None	Routine Cleaning	(1)
Bar Rack CSO 041	7/20/2026	Good	None	Routine Cleaning	(1)

Notes:

(1) System was designed so that captured solids and floatables are conveyed to Blue Plains for treatment.

4.3 Anacostia River Floating Debris Removal Program

This program was initiated in October 1992 to remove floating debris from Anacostia and Potomac Rivers on a routine basis. The program has continued from that time and is now under the auspices of DC WATER, Department of Sewer Operations. The floating debris removal program utilizes a skimmer boat and support boats to remove floatable debris from the Rivers as well as trash, which accumulates on the riverbanks and in the mud flats at low tides. Work for the most part is directed toward the Anacostia River. The boats pick up debris five days a week. Operations are summarized as follows:

Table 4-3
Anacostia River Floating Debris Removal Program – Summary

<i>Program Operation</i>	5-day work week, excluding holidays, weather permitting
<i>Work Days this month:</i>	22
<i>Days not Operating</i>	3
<i>Reason not Operating</i>	Maintenance, wind, low water levels.
<i># Skimmer in Fleet</i>	3 Skimmers
<i># Skimmers Out of Service</i>	1 Skimmer
<i>Dates</i>	B34: July 1 - July 31.
<i>Reason</i>	B34: No. 1 screen off track.
<i>Plan to Restore to Service</i>	B34: ETR September 2026.
<i>Amount Material Collected</i>	2 tons this month. Calendar year to date 20 tons.
<i>Nature of Material</i>	Bottles, cans, natural debris, and plastics.

4.4 CSS Litter Control

This section describes DC WATER's efforts to coordinate litter control efforts with the National Park Service and D.C. Department of Public Works to maximize litter control efforts in the combined sewer system.

No Activity this month.

5. MONITORING

5.1 Condition Report Bar Racks at Main and O Street Storm Pumps

DC Water performs visual surveys of the bar racks at Main and O Street Pumping Stations to characterize the quantity and nature of floatable discharge. The physical condition of the bar racks and any maintenance requirements are also noted.

Table 5-1
Bar Racks at Main & O Street Pumping Stations

Pumping Station	Date Inspected	Condition		Work Order Number	Work Needed	Work Performed or Schedule for Completion
		Good	Needs Work			
Bar Racks at O Street Storm Pumps (CSO 010)	7/03/26	X		26-634010		
Bar Racks at Main Storm Pumps (CSO 011)	7/03/26	X		26-634003		


5.2 Rain Data

Rain data from National Airport and from the rain gauges installed in the CSS are summarized below.

Date	Brentwood Pumping Station	Bryant Street Pumping Station	Main Pumping Station	Rock Creek Pumping Station	National Airport
7/1/2026	0	0	0	0	0
7/2/2026	0	0	0	0	0
7/3/2026	0	0	0	0	0
7/4/2026	0.01	0	0.02	0.01	0.08
7/5/2026	0	0	0.11	0	0
7/6/2026	0.01	0.01	0.16	0.02	0.13
7/7/2026	0.08	0.08	0.16	0.11	0.14
7/8/2026	0	0	0	0	0
7/9/2026	0.43	0.35	0.86	0.78	0.65
7/10/2026	0	0	0.06	0.01	0.67
7/11/2026	0	0	0	0	0
7/12/2026	0	0	0	0	0
7/13/2026	0	0	0	0	0
7/14/2026	0	0	0	0	0
7/15/2026	0	0	0	0	0
7/16/2026	0	0	0	0	0
7/17/2026	0	0	0	0	0
7/18/2026	0.15	0.13	0.60	0.16	0.61
7/19/2026	0	0	0	0	0
7/20/2026	0	0	0	0	0
7/21/2026	0.40	0.37	0.62	0.44	0.95
7/22/2026	0	0	0	0	0
7/23/2026	0	0	0	0	0
7/24/2026	0	0	0	0	0
7/25/2026	0	0	0	0	0.01
7/26/2026	0	0	0	0	0
7/27/2026	0	0	0	0	0
7/28/2026	0.81	0.66	0.78	0.82	0.34
7/29/2026	0	0	0	0	0
7/30/2026	0	0	0	0	0
7/31/2026	0	0	0	0	0
TOTAL	1.89	1.60	3.37	2.35	3.58

5.3 Wet Weather Overflows

The wet weather overflow data for this quarter is reported below in the Combined Sewer System Modeled and Metered Quarterly Results table located in Section 5.3 of the September 2026 Report.

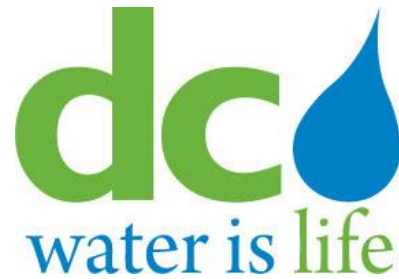

**DISTRICT OF COLUMBIA
WATER AND SEWER AUTHORITY**
Serving the Public • Protecting the Environment

Monthly Operations Report For *Combined Sewer System*

Month: August 2026

Prepared By:
District of Columbia
Water and Sewer Authority
Department of
Pumping and Sewer Operations
Washington, D.C. 20003

DISTRICT OF COLUMBIA
WATER AND SEWER AUTHORITY
Washington, D.C.

Monthly Operations Report for Combined Sewer System
Month: August 2026
Table of Contents

- 1. INTRODUCTION**
- 2. OPERATION AND MAINTENANCE**
 - 2.1 Regulators
 - 2.2 Outfalls, Tide Gates and CSO Signs
 - 2.3 Pumping Stations
 - 2.4 Inflatable Dams and SCADA Systems
- 3. DRY WEATHER OVERFLOWS**
- 4. SOLIDS AND FLOATABLES CONTROL**
 - 4.1 Catch Basin Cleaning
 - 4.2 BMP Demonstration for Solid and Floatable Control
 - 4.3 Anacostia River Floating Debris Removal Program
 - 4.4 CSS Litter Control
- 5. MONITORING**
 - 5.1 Bar Racks at Main & O Street
 - 5.2 Rainfall Data
 - 5.3 Wet Weather Overflows

1. INTRODUCTION

The District of Columbia Water and Sewer Authority (DC Water) operates a wastewater collection system comprised of separate and combined sewers. Separate storm and sanitary sewers serve two-thirds of the District. In the combined sewer system (CSS), there is a single sewer to convey storm water and sanitary wastes. The area served by combined sewers comprises about one-third of the District.

During dry weather, sanitary wastes collected in the CSS are conveyed to the DC Water's advanced wastewater treatment plant at Blue Plains (BPAWWTP or the Blue Plains AWWTP). During periods of rainfall, the capacity of a combined sewer may be exceeded and the excess flow, which is a mixture of storm water and sanitary wastes, is discharged directly to the Anacostia River, Rock Creek or the Potomac River or their tributary waters. This report summarizes the operations of the combined sewer system for the month indicated.

2. OPERATION AND MAINTENANCE

2.1 Regulators

Regulators divert combined sewage to interceptors, which convey flow to BPAWWTP for treatment. When flows exceed the capacities of the systems such as during significant rain events, regulators divert excess flow to the tunnel system for temporary storage, and CSO outfalls which discharge to receiving waters. The following table summarizes inspections of CSO regulators in the collection system.

**Table 2-1
Regulator Structures**

Structure Number	Location	Associated NPDES Outfall	Date Inspected	Condition		Work Needed	Work performed
				Good	Needs Work		
2 ¹	Bolling AFB, 2250 ft. north of the south line of the Base, SW	003	N/A				
4 ¹	Bolling AFB, 2250 ft. north of the south line of the Base, SW	003	N/A				
5 ¹	Poplar Point Pumping Station	004	N/A				
6	Chicago Street and Railroad Ave, SE	005	08/13/2026	*			
7	W Street and Railroad Ave, SE	005	08/06/2026	*			
8 ¹	Good Hope Rd, west of Nichols Ave, SE	006	N/A				
9	13 th Street and Ridge Place, SE (Diversion Structure)	007	08/06/2026	*			
9a	13 th Street and Ridge Place, SE (Regulator Structure)	007	08/06/2026	*			
9b	11 th Street Bridge and DC 295 SB (CSO-007 Diversion Chamber)	007	08/17/2026	*			
11	"O" Street Pumping Station	011(a)	08/06/2026	*			
12	Storm Pump Discharge at Main Pumping Station	011	08/10/2026	*			
13	2 nd Street, 300 ft. north of N Place, SE	009	08/06/2026	*			
14	2 nd Street, 250 ft. north of N Place, SE	011(a)	08/25/2026	*			
15	South Capitol and E Streets	010	08/18/2026	*			
15a	Half and L Streets, SE	010	08/18/2026	*			
15b	South Capitol and I Streets	010	08/06/2026	*			
15c	South Capitol and I Streets	010	08/06/2026	*			

Structure Number	Location	Associated NPDES Outfall	Date Inspected	Condition		Work Needed	Work performed
				Good	Needs Work		
16	North of Main Sewage Pumping Station	012	08/25/2026	*			
17	4 th and N Streets, SE, Both Extended	013	08/04/2026	*			
17a	K Street between 6 th Street and 7 th Street, SE (Side Overflow Weir)	013	08/04/2026	*			
17b	4 th and N Streets, SE, Both Extended (CSO-013 Diversion Chamber)	013	08/04/2026	*			
18	6 th and M Streets, SE (Diversion and Overflow Structure)	014	08/04/2026	*			
18a	Tingey Street SE and 5 1 / 2 Street SE (CSO-014 Diversion Chamber)	014	08/28/2026	*			
19	9 th and M Streets, SE	015	08/04/2026	*			
19a	9 th and M Streets, SE	015	08/04/2026	*			
19b	9 th and M Streets, SE (Diversion Chamber)	015	08/04/2026	*			
19c	9 th and M Streets, SE (Diversion Chamber)	015	08/04/2026	*			
20	12 th and M Streets, SE	016	08/04/2026	*			
20a	12 th and M Streets, SE	016	08/04/2026	*			
20b	12 th and M Streets, SE (CSO-016 Diversion Chamber)	016	08/04/2026	*			
21	14 th and M Streets, SE	017	08/04/2026	*			
21a	14 th and M Streets, SE (CSO-017 Diversion Chamber)	017	08/04/2026	*			
22a	Barney Circle and Pennsylvania Ave, SE	018	08/06/2026	*			
22b	Barney Circle and Pennsylvania Ave, SE	018	08/06/2026	*			
22c	Barney Circle and Pennsylvania Ave, SE	018	08/06/2026	*			
22d	Kentucky Ave and Potomac Street, SE	018	08/06/2026	*			
22e	14 th Street and Kentucky Ave, SE	018	08/06/2026	*			
23	Independence Ave, 21 st Street, SE, Extended	019	08/06/2026	*			
24a	East Capitol St, west of RFK stadium	019	08/06/2026	*			
28	21 st and Constitution Ave, NW	020	08/03/2026	*			
29	22 nd Street, between Constitution Ave and C St, NW	020	08/03/2026	*			
30	17 th and D Streets, NW	020	08/03/2026	*			
31	15 th Street and Pennsylvania Ave, NW	020	08/03/2026	*			
33	10 th and F Streets, NW	020	08/03/2026	*			
34	23 rd Street, north of Constitution Ave, NW	020	08/18/2026	*			
34a	23 rd Street near C Street, NW	020	08/03/2026	*			
35	Northeast of Roosevelt Bridge, NW	021	08/18/2026	*			
35c	Kennedy Center Rock Creek and Potomac Pkwy Northeast of Roosevelt Bridge, NW	021	08/18/2026	*			
36	27 th and I Streets, NW	022	08/03/2026	*			
36a	New Hampshire Ave and Eye Street, NW	022	08/03/2026	*			

Structure Number	Location	Associated NPDES Outfall	Date Inspected	Condition		Work Needed	Work performed
				Good	Needs Work		
36b	19 th and L Streets, NW	022, 034	08/11/2026	*			
36d	17 th and L Streets, NW	022, 034	08/11/2026	*			
36g	18 th and M Streets, NW	022, 034	08/11/2026	*			
36h	18 th and M Streets, NW	022, 034	08/11/2026	*			
37	27 th and Eye Streets, NW	022	08/03/2026	*			
38	29 th and K Streets, NW	024	08/03/2026	*			
38a	30 th Street, south of K Street, NW	024	08/03/2026	*			
39a	30 th and K Streets, NW	024	08/03/2026	*			
39b	30 th and K Streets, NW	024	08/03/2026	*			
41b ¹	31 st and K Streets, NW	025	N/A				
41c ¹	31 st and K Streets, NW	025	N/A				
42 ¹	Wisconsin Ave and K Street, NW	026	N/A				
43	Potomac and Water Streets, NW	027	08/03/2026	*			
43a	Potomac and Water Streets, NW	027	08/03/2026	*			
44	Water Street, west of Potomac St, NW	027	08/03/2026	*			
45	36 th and M Streets, NW	028	08/11/2026	*			
46	Canal Rd, 1000ft. east of Foxhall Rd, NW	029	08/11/2026	*			
47	38 th Street and Reservoir Road, NW	029	08/11/2026	*			
47a	37 th and T Streets, NW	029	08/11/2026	*			
47b	37 th and T Streets, NW	029	08/11/2026	*			
47c	38 th and W Streets, NW	029	08/11/2026	*			
49 ¹	Pennsylvania Ave, east side of Rock Creek, NW	031	N/A				
50	26 and M Streets, NW	032	08/31/2026	*			
51	N Street Extended, west of 25 th Street, NW	033	08/31/2026	*			
52	22 nd Street between M and N Streets, NW	034	08/18/2026	*			
52a	N Street between 22 nd and 23 rd Streets, NW	034	08/18/2026	*			
53	22 nd and M Streets, NW	022, 034	08/18/2026	*			
53a	22 nd and M Streets, NW	022, 034	08/18/2026	*			
53b	L Street between 21 st Street and New Hampshire Ave, NW	022, 034	08/11/2026	*			
53c	L and 22 nd Streets, NW	022	08/11/2026	*			
54	23 rd and O Streets, NW	034	08/17/2026	*			
55	22 nd Street, south of Q Street, NW	035	08/17/2026	*			
55a	22 nd Street, south of Q Street, NW	035	08/17/2026	*			

Structure Number	Location	Associated NPDES Outfall	Date Inspected	Condition		Work Needed	Work performed
				Good	Needs Work		
56	23 rd and Massachusetts Ave, NW	036	08/17/2026	*			
57	23 rd Street, south of Q Street, NW	036	08/17/2026	*			
58 ¹	Northwest of Belmont Road and Rock Creek and Potomac Parkway, NW	037	N/A				
59	North of Belmont Rd, east of Kalorama Cir, NW	038	08/27/2026	*			
60	Connecticut Ave, east of Rock Creek, NW	039	08/05/2026	*			
61	Biltmore St, Extended, east of Rock Creek, NW	040	08/05/2026	*			
62	Ontario Rd, Extended, and Rock Creek Pkwy, NW	041	08/12/2026	*			
63	Harvard Street and Rock Creek Parkway, NW	042	08/12/2026	*			
64	Adams Mill Road, south of Irving Street, NW	043	08/12/2026	*			
65	Kenyon Street and Adams Mill Road, NW	044	08/12/2026	*			
65a	Kenyon Street and Adams Mill Road, NW	044	08/12/2026	*			
66	Adams Mill Road and Lamont Street, NW	045	08/12/2026	*			
67	Park Rd , south of Piney Branch Pkwy, NW	046	08/12/2026	*			
68	Ingleside Terrance, Extended and Piney Branch Parkway, NW	047	08/12/2026	*			
69	Mt. Pleasant Street, Extended and Piney Branch Parkway, NW	048	08/12/2026	*			
70	Piney Branch Parkway, west of 16 th Street, NW	049	08/12/2026	*			
70i	5 th and Quackenbos Streets, NW	049	08/12/2026	*			
71	28 th Street, west of Rock Creek Parkway, NW	050	08/27/2026	*			
72	Olive Street Extended and Rock Creek Pkwy, NW	051	08/17/2026	*			
72a	Olive Street Extended and Rock Creek Pkwy, NW	051	08/17/2026	*			
73	O Street Extended and Rock Creek Parkway, NW	052	08/27/2026	*			
74 ¹	Q Street, west of Rock Creek, NW	053	N/A				
75	West side of Rock Creek, 300 ft. south of Massachusetts Ave, NW	054	08/27/2026	*			
77	Normanstone Dr Extended, west of Rock Creek, NW	056	08/27/2026	*			
77a	Normanstone Dr and Normanstone Lane, NW	056	08/27/2026	*			
78 ¹	28th Street Extended, west of Rock Creek, NW	057	N/A				
79 ¹	Connecticut Ave and Rock Creek Parkway, NW	058	N/A				
84	26 th and P Streets, NW	060	08/17/2026	*			
84a	26 th and P Streets, NW	060	08/17/2026	*			
86	Diversion Chamber and Vortex Drop at First and Channing St, NW (First St Tunnel)	019	08/26/2026	*			
88	Flagler and Adams St. NW (First St Tunnel)	019	08/26/2026	*			
89	First and V St, NW (First St Tunnel)	019	08/26/2026	*			

Structure Number	Location	Associated NPDES Outfall	Date Inspected	Condition		Work Needed	Work performed
				Good	Needs Work		
90	First and V St, NW (First St Tunnel)	019	08/26/2026	*			
91	First and V St, NW (First St Tunnel)	019	08/26/2026	*			
92	CSO 019 Diversion Near Eastside PS (Anacostia River Tunnel)	019	08/28/2026	*			
93	CSO 018 Diversion Near Barney Circle (Anacostia River Tunnel)	018	08/28/2026	*			
95	M Street Approach Channel M and Water St SE (Anacostia River Tunnel)	015, 016, 017	08/04/2026	*			
96	CSO 007 Shaft at 11 th St Bridge and DC I-295 SB Diversion Facilities (Anacostia River Tunnel)	007	08/28/2026	*			
97	CSO 005 Diversion at Chicago St Trunk Sewer, I295 SB (Anacostia River Tunnel)	005	08/28/2026	*			
98	Main Pumping Station Diversions (Anacostia River Tunnel)	009 – 012	08/28/2026	*			
99	CSO 009 and 011a Diversion Facilities (Anacostia River Tunnel)	009, 011a	08/25/2026	*			
100	CSO 012 Diversion Facilities (Anacostia River Tunnel)	012	08/25/2026	*			
101	Main Outfall Sewer Diversion Chamber (Anacostia River Tunnel)	N/A	08/13/2026	*			
102	Anacostia Main Interceptor Diversion Chamber	N/A	08/13/2026	*			
103	Poplar Point PS Emergency Overflow Chamber (Anacostia River Tunnel)	N/A	08/13/2026	*			
104	Poplar Point PS Discharge Chamber	N/A	08/13/2026	*			
105	Potomac Outfall Sewer Diversion Chamber (Anacostia River Tunnel)	003A	08/13/2026	*			
106	R Street Diversion Chamber (RS-DC) and R Street Drop Shaft (RS-DS)	019	08/26/2026	*			
107	Florida Avenue Diversion Chamber (FLA-DC), Florida Avenue Drop Shaft (FLA-DS)	019	08/26/2026	*			
108	T Street Junction Chamber (TS-JC), T Street Drop Shaft (TS-DS)	019	08/26/2026	*			
109	4th Street NE Diversion Chamber (4S-DC), 4th Street Drop Shaft (4S-DS)	019	08/26/2026	*			
110	Rhode Island Avenue Diversion Chamber (RIA-DC), Rhode Island Avenue Drop Shaft (RIA-DS)	019	08/26/2026	*			
111a	Mount Olivet Road Junction Chamber (MOR-JC)	019	08/26/2026	*			
111b	Mount Olivet Road Diversion Chamber (MOR-DC)	019	08/26/2026	*			
111c	Mount Olivet Road Drop Shaft (MOR-DS)	019	08/26/2026	*			

Notes:

1. Noted structures no longer function as a combined sewer overflow regulator structure.

2.2 Outfalls, Tide Gates and CSO Signs

The following table summarizes inspections, maintenance and work performed on outfall structures, tide gates and CSO signs in the collection system.

Table 2-2
Outfalls and Tide Gates

NPDES Outfall	Location	Date Inspected	Outfall Condition		Tide Gate Present?		Tide Gate Condition		CSO Sign		Notes, Work Needed or Performed
			OK	Needs Work	Yes	No	OK	Needs Work	OK	Needs Work	
003 ¹	Bolling Air Force Base, at Giavanolli and Chanute, SW	N/A									
003a	Joint Base Anacostia Bolling Macdill and Arnold Ave SW	08/13/2026	*		*		*		*		
005	Across from Navy Yard, aligned with Parsons Ave., SE	08/10/2026	*		*		*		*		
006 ¹	Good Hope Road and Welsh Memorial Bridge	N/A									
007	Between 11 th St. and Anacostia Bridges, SE	08/10/2026	*		*		*		*		
009	O St. Sewage Pumping Station, SE	08/10/2026	*		*		*		*		
010	O St. Sewage Pumping Station, SE	08/10/2026	*			*			*		
011	Main Sewage Pumping Station, SE	08/10/2026	*			*			*		
011a	Main Sewage Pumping Station, SE	08/10/2026	*		*		*		*		
012	Main Sewage Pumping Station, SE	08/10/2026	*		*		*		*		
013	Southeast Federal Center, aligned with 4 th St.	08/10/2026	*		*		*		*		
014	Navy Yard, aligned with 6 th St., SE	08/10/2026	*		*		*		*		
015	Navy Yard, aligned with 9th Street, SE	08/10/2026	*			*			*		
016	12th and O Streets, SE	08/10/2026	*		*		*		*		
017	M and Water Street, SE	08/10/2026	*		*		*		*		
018	East of Barney Circle & South of Pennsylvania Avenue Bridge, SE	08/10/2026	*		*		*		*		
019	Adjacent to Service Drive behind swirl facility & D.C. General Hospital	08/28/2026	*		*		*		*		
019a	Adjacent to Service Drive behind swirl facility & D.C. General Hospital (Tunnel Overflow Structure)	08/28/2026	*		*		*		*		
020	Rock Creek Parkway and Independence, NW	08/07/2026	*		*		*		*		
021	Rock Creek Parkway and C St., NW	08/07/2026	*		*		*		*		
022	Rock Creek Parkway and G St., NW	08/07/2026	*		*		*		*		
024	South of 30 th and K Streets, NW	08/03/2026	*		*		*		*		
025 ¹	South of 31st and K Streets, NW	N/A									
026 ¹	Wisconsin Avenue and Water Street, NW	N/A									
027	33 rd and Water Sts., NW	08/03/2026	*			*			*		
028	Key Bridge and Whitehurst Freeway, NW	08/07/2026	*			*			*		
029	Adjacent to C&O Canal, aligned with 38 th St. NW	08/07/2026	*			*			*		

NPDES Outfall	Location	Date Inspected	Outfall Condition		Tide Gate Present?		Tide Gate Condition		CSO Sign		Notes, Work Needed or Performed
			OK	Needs Work	Yes	No	OK	Needs Work	OK	Needs Work	
031 ¹	Rock Creek Pkwy & Pennsylvania Avenue, NW	N/A									
032	26th and M Street, NW	08/31/2026	*			*			*		
033	Across street from St. Francis Jr. High and aligned with N St., NW.	08/31/2026	*		*		*		*		
034	Just west of St. Francis Jr. High and north of N St., NW	08/17/2026	*			*			*		
035	P St. Bridge and Rock Creek Parkway	08/17/2026	*			*			*		
036	22nd Street, South of Q Street NW.	08/07/2026	*		*		*		*		
037 ¹	Waterside Dr. and Rock Creek Parkway	N/A									
038	Between arch footbridge and Connecticut Ave., north of Kalorama Circle, NW.	08/27/2026	*		*		*		*		
039	Connecticut Avenue Bridge and Rock Creek Parkway, NW.	08/05/2026	*		*		*		*		
040	Aligned with Biltmore Rd., between Connecticut Ave and Ellington Bridge.	08/05/2026	*		*		*		*		
041	Beach Dr. and Ontario Pl., NW	08/07/2026	*		*		*		*		
042	Harvard St. and Beach Dr NW.	08/07/2026	*		*		*		*		
043	Upstream of Harvard St. and Beach Dr NW.	08/07/2026	*		*		*		*		
044	Kenyon Street and Beach Dr., NW.	08/07/2026	*		*		*		*		
045	North of Beach Dr. and Walbridge Pl, NW.	08/07/2026	*		*		*		*		
046	Piney Branch Parkway and Park Road, NW.	08/12/2026	*			*			*		
047	Piney Branch Parkway and Ingleside Terrace	08/12/2026	*		*		*		*		
048	South of Piney Branch Parkway and 17 th St.	08/12/2026	*		*		*		*		
049	North of Piney Branch Parkway and 17 th St.	08/12/2026	*		*		*		*		
050	Rock Creek Parkway and L St., NW	08/07/2026	*		*		*		*		
051	Across Rock Creek Pkwy, aligned with Olive St., NW.	08/27/2026	*		*		*		*		
052	Between P & Penna. Ave Bridges, aligned with O Street, NW.	08/27/2026	*		*		*		*		
053 ¹	Q St. Bridge and Rock Creek Parkway, NW.	N/A									
054	Massachusetts Ave & Rock Creek Parkway, NW.	08/27/2026	*		*		*		*		
056	Normanstone Dr. and Rock Creek Parkway, NW.	08/27/2026	*		*		*		*		
057 ¹	28th Street and Rock Creek Parkway, NW	N/A									
058 ¹	Connecticut Ave & Rock Creek Parkway, NW.	N/A									
060	North of P St. Bridge & Rock Creek Pkwy, NW	08/07/2026	*		*		*		*		

Notes:

1. Outfall no longer functions as a combined sewer outfall.

Pumping Stations

Pumping station operations are summarized in the table below.

Table 2-3
Pumping Stations – Inspections and Equipment in Service

<i>Pumping Station</i>	<i>No. of Inspections</i>	<i>No. Screens</i>	<i>No. Pumps</i>	<i>Screens or Pumps Out of Service</i>	<i>Dates</i>	<i>Reason</i>	<i>Work Order Number</i>	<i>Schedule to Restore to Service</i>
Main	31	3	4	Screen 4 ³	08/01/26-08/31/26	Screen motor failure	26-368268	Anticipated return to service 10/31/26
O Street	31	2	4	Screen 2 ³	08/01/26-08/31/26	High motor alarm	26-29851	Anticipated return to service 10/31/26
				Pump 4 ²	08/01/26-08/31/26	Actuator needs to be replaced	26-120944	Anticipated return to service 10/31/26
Eastside	1	2	4	Pump 4	08/01/26-08/14/26	Suction and discharge issue	26-368268	Returned to service 08/14/26
Poplar Point	1	2	4	None	-	-	-	-
Potomac	31	4	5	Pump 1 ¹	08/01/26-08/31/26	Motor needs repair	25-579179	Anticipated return to service 02/28/27
				Pump 5	08/01/26-08/18/26	Starter Fault	26-425688	Returned to service 8/18/26

Notes:

1. Manufacturer parts aren't readily available, so we continue to wait for replacement parts to be built and delivered. Upgrade CIP project underway to replace with new equipment.
2. Contractors working underground, actuator will be replaced once work is completed
3. Manufacturer parts aren't readily available, so we continue to wait for replacement parts to be delivered.

Table 2-4
Pumping Stations – Preventive Maintenance

<i>Pumping Station</i>	<i>Date Performed</i>	<i>Type of Preventive Maintenance Performed¹</i>	<i>Work Order Number</i>	<i>Comments</i>
Main	08/05/26	Group A	26-661930	Add oil, grease bearings and replace packing if needed.
O St	08/05/26	Group A	26-687949	Add oil, grease bearings and replace packing if needed.
Eastside	08/10/26	Group A	26-626331	Add oil, grease bearings and replace packing if needed.
Poplar Point	08/10/26	Group A	26-665042	Add oil, grease bearings and replace packing if needed.
Potomac	08/05/26	Group A	26-689193	Add oil, grease bearings and replace packing if needed.
Rock Creek	08/10/26	Group A	26-602045	Add oil, grease bearings and replace packing if needed.
Upper Anacostia	08/10/26	Group A	26-665219	Add oil, grease bearings and replace packing if needed.
Earl Place	08/10/26	Group A	26-634353	Add oil, grease bearings and replace packing if needed.

Notes:

1. Group A consists of:
 - a. Exercise bar screens
 - b. Exercise all sump pumps
 - c. Drain condensation from air compressor storage tank
 - d. Check depth of screening in the screen room and schedule Vactor truck as required
 - e. Check all safety equipment
 - f. Issue work order requests as required

Table 2-5
Pumping Stations – Pumpage

	<i>Sanitary Pumpage</i>		<i>Screenings Collected (tons)¹</i>
<i>Pumping Station</i>	<i>Total Wastewater (mg)</i>	<i>Daily Average Wastewater (mg)</i>	
Main ^{1,2}	1076.24	34.72	N/A
O St ^{1,2}	161.278	5.20	N/A
Eastside	109.75	3.54	N/A
Poplar Point	279.67	9.02	N/A
Potomac	3217.19	103.78	N/A
Rock Creek ³	28.38**	0.915**	N/A
Upper Anacostia	31.81	1.03	N/A
Earl Place	0.1098	0.0035	N/A

Notes:

1. Screenings collected from the Main and O Street Pumping Stations are combined from the sanitary flow and combined sewer overflows, due to the design of the screening system that consists of vertical trash racks, with no mechanical cleaning. Therefore, quantification of captured screening materials, specifically from combined sewer overflows, is not feasible.
2. Flow meters have been installed in accordance with NPDES Permit No. DC002199 to record CSO discharges from Main and O Street Pumping Stations. This data is reported via Discharge Monitoring Reports submitted to the EPA on a monthly basis. A summary of metered and modeled CSO discharges is included in Section 5.
3. In April 2025, instrumentation began work to replace the flow meter on Pump #2 at Rock Creek PS. Replacement will occur once the flow meter supplier is able to send out new equipment. See WO# 25-385565 **Values above are directly from SCADA software

2.3 Inflatable Dams and SCADA System

DC Water operates and maintains nine inflatable dams at seven different locations. Table 2-6 summarizes the date(s) the inflatable dams were inspected, and their operational status and condition. The inflatable dams consist of multi-ply elastomeric (i.e., “rubber”) fabric dams installed in major overflow conduits within the combined sewer system. The objective of the inflatable dam installation is to increase the effective depth to which the sewage must rise in the combined sewer before overflows occur. The effect of the installation is to retain a greater volume of combined sewage flow resulting from low to moderate intensity storms by maximizing storage within the CSS. During higher intensity storms, when the full carrying capacity of the overflow conduit is required to prevent upstream flooding, the dam is deflated automatically. Inflatable dam operations are summarized below:

Table 2-6
Inflatable Dams – Inspections and Equipment in Service

<i>Inflatable Dam Structure No</i>	<i>Date Inspected</i>	<i>Was Dam Out of Service During the Month?</i>	<i>Dates out of Service</i>	<i>Reason</i>	<i>Schedule to Restore to Service</i>
14 – East	8/25/26	No	N/A	N/A	N/A
14 – West	8/25/26	No	N/A	N/A	N/A
15	8/18/26	No	N/A	N/A	N/A
15A	8/18/26	No	N/A	N/A	N/A
16 – East	8/25/26	No	N/A	N/A	N/A
16 – West	8/25/26	No	N/A	N/A	N/A
34	8/18/26	No	N/A	N/A	N/A
35	8/18/26	No	N/A	N/A	N/A
52	8/18/26	No	N/A	N/A	N/A

Notes:

**Table 2-7
Inflatable Dams & SCADA Sites – Wet Weather Operations**

<i>Inflatable Dam Structure No.</i>	<i>Overflow Dates</i>	<i>Estimated Duration of Overflow</i>	<i>Inflatable Dam Operational Status</i>
14 (E & W)	<i>None</i>	<i>N/A</i>	<i>Inflated</i>
15	<i>None</i>	<i>N/A</i>	<i>Inflated</i>
15A	<i>None</i>	<i>N/A</i>	<i>Inflated</i>
16 (E & W)	<i>None</i>	<i>N/A</i>	<i>Inflated</i>
34	<i>None</i>	<i>N/A</i>	<i>Inflated</i>
35	8/2/26	2hrs 5mins	Deflated
	8/10/26	26mins	Deflated
	8/20/26	46mins	Deflated
	8/22/26	40mins	Deflated
52	<i>None</i>	<i>N/A</i>	<i>Inflated</i>
<i>Structures on Outfall Sewers</i>	<i>Overflow Dates</i>	<i>Estimated Duration of Overflow</i>	<i>N/A</i>
Outfall Structure 1	None	This structure has been bulk headed. Overflows are no longer possible.	
Outfall Structure 1A	None	This structure has been bulk headed. Overflows are no longer possible.	
Outfall Structure 2	None	N/A	
<i>Outfall Sewer Control Gates</i>	<i>Operational Status</i>	<i>Position</i>	
Outfall Sewer Control Gate No.1	Operational	Open	
Outfall Sewer Control Gate No.2	Operational	This structure has been bulk headed. Overflows are no longer possible	
Outfall Sewer Control Gate No.2	Operational	This structure has been bulk headed. Overflows are no longer possible	

Notes:

3. DRY WEATHER OVERFLOWS

There was no dry weather combined sewer overflow reported during August 2026.

4. SOLIDS AND FLOATABLES CONTROL

4.1 Catch Basin Cleaning

The following tables summarize catch basin cleaning in the Anacostia CSO area and in the entire sewer system:

**Table 4-1
Catch Basin Cleaning**

Ward	Total CBs	CBs in CSS	Inspections			Cleaning					
			CBs in Anacostia CSS	Total Anacostia CBs Inspected Once this Year	Total Anacostia CBs Inspected Twice this Year	CBs Cleaned Thru Last Month		CB's Cleaned This Month		Total CBs Cleaned This Year to Date	
						Total	In CSS	Total	In CSS	Total	In CSS
1	1467	1442	655	478	30	313	296	295	295	608	591
2	2832	2647	486	318	35	311	203	518	518	829	721
3	3720	183	0	0	0	3479	18	139	137	3618	155
4	3521	1729	0	0	0	3240	1566	108	108	3348	1674
5	4066	1758	1693	1095	79	2421	130	53	7	2474	137
6	3333	2692	2676	1943	177	822	179	70	70	892	249
7	3879	43	43	41	0	3599	3	39	0	3638	3
8	2930	213	212	7	0	1803	7	38	0	1841	7
Grand Total	25748¹	10707¹	5765¹	3879	321	15988	2402	1260	1135	17248	3537
% Cleaned/Inspected to Date				67%	6%					67%	32%

Notes:

1. The number of catch basins in our service area changes with the ongoing connections and abandonments to the sewer infrastructure.

4.2 BMP Demonstration for Solid and Floatable Control

DC WATER operates the following demonstration projects designed to remove solids and floatables from CSO prior to discharge.

- Bar Rack at CSO 040 and 041 to Rock Creek

Table 4-2
BMP Demonstration Projects – Report

<i>Facility</i>	<i>Date Inspected</i>	<i>Condition</i>	<i>Work Needed</i>	<i>Work performed</i>	<i>Material Removed (LB)</i>
Bar Rack CSO 040	08/05/2026	Good	None	Routine Cleaning	(1)
Bar Rack CSO 041	08/07/2026	Good	None	Routine Cleaning	(1)

Notes:

(1) System was designed so that captured solids and floatables are conveyed to Blue Plains for treatment.

4.3 Anacostia River Floating Debris Removal Program

This program was initiated in October 1992 to remove floating debris from Anacostia and Potomac Rivers on a routine basis. The program has continued from that time and is now under the auspices of DC WATER, Department of Sewer Operations. The floating debris removal program utilizes a skimmer boat and support boats to remove floatable debris from the Rivers as well as trash, which accumulates on the riverbanks and in the mud flats at low tides. Work for the most part is directed toward the Anacostia River. The boats pick up debris five days a week. Operations are summarized as follows:

Table 4-3
Anacostia River Floating Debris Removal Program – Summary

<i>Program Operation</i>	5-day work week, excluding holidays, weather permitting
<i>Work Days this month:</i>	21
<i>Days not Operating</i>	4
<i>Reason not Operating</i>	Maintenance, wind, low water levels.
<i># Skimmer in Fleet</i>	3 Skimmers
<i># Skimmers Out of Service</i>	2 Skimmer
<i>Dates</i>	B34: August 1 - August 31. B37: August 27 – August 31
<i>Reason</i>	B34: No. 1 screen off track. B37: Broken weld on starboard wing
<i>Plan to Restore to Service</i>	B34: ETR December 2026. B37: ETR October 2026.
<i>Amount Material Collected</i>	1 ton this month. Calendar year to date 21 tons.
<i>Nature of Material</i>	Bottles, cans. natural debris, and plastics.

4.4 CSS Litter Control

This section describes DC WATER's efforts to coordinate litter control efforts with the National Park Service and D.C. Department of Public Works to maximize litter control efforts in the combined sewer system.

No Activity this month.

5. MONITORING

5.1 Condition Report Bar Racks at Main and O Street Storm Pumps

DC Water performs visual surveys of the bar racks at Main and O Street Pumping Stations to characterize the quantity and nature of floatable discharge. The physical condition of the bar racks and any maintenance requirements are also noted.

Table 5-1
Bar Racks at Main & O Street Pumping Stations

Pumping Station	Date Inspected	Condition		Work Order Number	Work Needed	Work Performed or Schedule for Completion
		Good	Needs Work			
Bar Racks at O Street Storm Pumps (CSO 010)	8/5/26	X		26-685375		
Bar Racks at Main Storm Pumps (CSO 011)	8/5/26	X		26-685368		


5.2 Rain Data

Rain data from National Airport and from the rain gauges installed in the CSS are summarized below.

Date	Brentwood Pumping Station	Bryant Street Pumping Station	Main Pumping Station	Rock Creek Pumping Station	National Airport
8/1/2026	0	0	0	0	0
8/2/2026	1.48	0.73	1.85	1.99	1.74
8/3/2026	0	0.02	0.02	0.07	0.01
8/4/2026	0	0	0	0	0
8/5/2026	0.59	0.42	0.61	0.21	0.49
8/6/2026	0.02	0.04	0.08	0.03	0.03
8/7/2026	0	0	0	0	0
8/8/2026	0	0	0	0	0
8/9/2026	0	0	0	0	0
8/10/2026	0.18	0.17	0.69	0.35	0.87
8/11/2026	0.01	0.01	0.01	0.01	0.02
8/12/2026	0	0	0	0	0
8/13/2026	0	0	0	0	0
8/14/2026	0	0	0	0	0
8/15/2026	0	0	0	0	0
8/16/2026	0.18	0.27	0	0.33	0.32
8/17/2026	0	0	0	0	0
8/18/2026	0	0	0	0	0
8/19/2026	0	0	0	0	0
8/20/2026	0.58	0.39	0.34	0.44	0.24
8/21/2026	0	0	0	0	0
8/22/2026	0.34	0.30	0.28	0.56	0.32
8/23/2026	0.08	0	0.09	0.11	0
8/24/2026	0	0	0	0	0
8/25/2026	0	0	0	0	0
8/26/2026	0	0	0	0	0
8/27/2026	0	0	0	0	0.05
8/28/2026	0	0	0	0	0
8/29/2026	0	0	0	0	0
8/30/2026	0.08	0.10	0.13	0.56	0.18
8/31/2026	0	0	0	0	0
TOTAL	3.54	2.45	4.10	4.66	4.27

5.3 Wet Weather Overflows

The wet weather overflow data for this quarter is reported below in the Combined Sewer System Modeled and Metered Quarterly Results table located in Section 5.3 of the September 2026 Report.

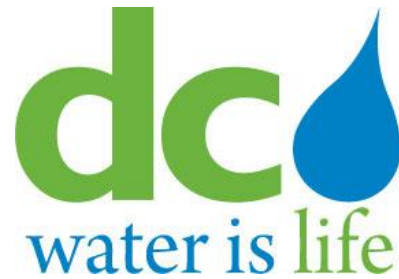

**DISTRICT OF COLUMBIA
WATER AND SEWER AUTHORITY**
Serving the Public • Protecting the Environment

Monthly Operations Report For *Combined Sewer System*

Month: September 2026

Prepared By:
District of Columbia
Water and Sewer Authority
Department of
Pumping and Sewer Operations
Washington, D.C. 20003

DISTRICT OF COLUMBIA
WATER AND SEWER AUTHORITY
Washington, D.C.

Monthly Operations Report for Combined Sewer System
Month: September 2026
Table of Contents

- 1. INTRODUCTION**
- 2. OPERATION AND MAINTENANCE**
 - 2.1 Regulators
 - 2.2 Outfalls, Tide Gates and CSO Signs
 - 2.3 Pumping Stations
 - 2.4 Inflatable Dams and SCADA Systems
- 3. DRY WEATHER OVERFLOWS**
- 4. SOLIDS AND FLOATABLES CONTROL**
 - 4.1 Catch Basin Cleaning
 - 4.2 BMP Demonstration for Solid and Floatable Control
 - 4.3 Anacostia River Floating Debris Removal Program
 - 4.4 CSS Litter Control
- 5. MONITORING**
 - 5.1 Bar Racks at Main & O Street
 - 5.2 Rainfall Data
 - 5.3 Wet Weather Overflows

1. INTRODUCTION

The District of Columbia Water and Sewer Authority (DC Water) operates a wastewater collection system comprised of separate and combined sewers. Separate storm and sanitary sewers serve two-thirds of the District. In the combined sewer system (CSS), there is a single sewer to convey storm water and sanitary wastes. The area served by combined sewers comprises about one-third of the District.

During dry weather, sanitary wastes collected in the CSS are conveyed to the DC Water's advanced wastewater treatment plant at Blue Plains (BPAWWTP or the Blue Plains AWWTP). During periods of rainfall, the capacity of a combined sewer may be exceeded and the excess flow, which is a mixture of storm water and sanitary wastes, is discharged directly to the Anacostia River, Rock Creek or the Potomac River or their tributary waters. This report summarizes the operations of the combined sewer system for the month indicated.

2. OPERATION AND MAINTENANCE

2.1 Regulators

Regulators divert combined sewage to interceptors, which convey flow to BPAWWTP for treatment. When flows exceed the capacities of the systems such as during significant rain events, regulators divert excess flow to the tunnel system for temporary storage, and CSO outfalls which discharge to receiving waters. The following table summarizes inspections of CSO regulators in the collection system.

Table 2-1
Regulator Structures

Structure Number	Location	Associated NPDES Outfall	Date Inspected	Condition		Work Needed	Work performed
				Good	Needs Work		
2 ¹	Bolling AFB, 2250 ft. north of the south line of the Base, SW	003	N/A				
4 ¹	Bolling AFB, 2250 ft. north of the south line of the Base, SW	003	N/A				
5 ¹	Poplar Point Pumping Station	004	N/A				
6	Chicago Street and Railroad Ave, SE	005	09/25/26	*			
7	W Street and Railroad Ave, SE	005	09/25/26	*			
8 ¹	Good Hope Rd, west of Nichols Ave, SE	006	N/A				
9	13 th Street and Ridge Place, SE (Diversion Structure)	007	09/25/26	*			
9a	13 th Street and Ridge Place, SE (Regulator Structure)	007	09/25/26	*			
9b	11 th Street Bridge and DC 295 SB (CSO-007 Diversion Chamber)	007	09/25/26	*			
11	"O" Street Pumping Station	011(a)	09/08/26	*			
12	Storm Pump Discharge at Main Pumping Station	011	09/28/26	*			
13	2 nd Street, 300 ft. north of N Place, SE	009	09/08/26	*			
14	2 nd Street, 250 ft. north of N Place, SE	011(a)	09/29/26	*			
15	South Capitol and E Streets	010	09/24/26	*			
15a	Half and L Streets, SE	010	09/24/26	*			
15b	South Capitol and I Streets	010	09/21/26	*			
15c	South Capitol and I Streets	010	09/21/26	*			

Structure Number	Location	Associated NPDES Outfall	Date Inspected	Condition		Work Needed	Work performed
				Good	Needs Work		
16	North of Main Sewage Pumping Station	012	09/30/26	*			
17	4 th and N Streets, SE, Both Extended	013	09/30/26	*			
17a	K Street between 6 th Street and 7 th Street, SE (Side Overflow Weir)	013	09/21/26	*			
17b	4 th and N Streets, SE, Both Extended (CSO-013 Diversion Chamber)	013	09/30/26	*			
18	6 th and M Streets, SE (Diversion and Overflow Structure)	014	09/21/26	*			
18a	Tingey Street SE and 5 1 / 2 Street SE (CSO-014 Diversion Chamber)	014	09/21/26	*			
19	9 th and M Streets, SE	015	09/21/26	*			
19a	9 th and M Streets, SE	015	09/21/26	*			
19b	9 th and M Streets, SE (Diversion Chamber)	015	09/21/26	*			
19c	9 th and M Streets, SE (Diversion Chamber)	015	09/21/26	*			
20	12 th and M Streets, SE	016	09/21/26	*			
20a	12 th and M Streets, SE	016	09/21/26	*			
20b	12 th and M Streets, SE (CSO-016 Diversion Chamber)	016	09/21/26	*			
21	14 th and M Streets, SE	017	09/21/26	*			
21a	14 th and M Streets, SE (CSO-017 Diversion Chamber)	017	09/21/26	*			
22a	Barney Circle and Pennsylvania Ave, SE	018	09/25/26	*			
22b	Barney Circle and Pennsylvania Ave, SE	018	09/25/26	*			
22c	Barney Circle and Pennsylvania Ave, SE	018	09/25/26	*			
22d	Kentucky Ave and Potomac Street, SE	018	09/25/26	*			
22e	14 th Street and Kentucky Ave, SE	018	09/25/26	*			
23	Independence Ave, 21 st Street, SE, Extended	019	09/30/26	*			
24a	East Capitol St, west of RFK stadium	019	09/21/26	*			
28	21 st and Constitution Ave, NW	020	09/09/26	*			
29	22 nd Street, between Constitution Ave and C St, NW	020	09/09/26	*			
30	17 th and D Streets, NW	020	09/09/26	*			
31	15 th Street and Pennsylvania Ave, NW	020	09/09/26	*			
33	10 th and F Streets, NW	020	09/09/26	*			
34	23 rd Street, north of Constitution Ave, NW	020	09/29/26	*			
34a	23 rd Street near C Street, NW	020	09/09/26	*			
35	Northeast of Roosevelt Bridge, NW	021	09/29/26	*			
35c	Kennedy Center Rock Creek and Potomac Pkwy Northeast of Roosevelt Bridge, NW	021	09/29/26	*			
36	27 th and I Streets, NW	022	09/09/26	*			
36a	New Hampshire Ave and Eye Street, NW	022	09/09/26	*			

Structure Number	Location	Associated NPDES Outfall	Date Inspected	Condition		Work Needed	Work performed
				Good	Needs Work		
36b	19 th and L Streets, NW	022, 034	09/14/26	*			
36d	17 th and L Streets, NW	022, 034	09/14/26	*			
36g	18 th and M Streets, NW	022, 034	09/14/26	*			
36h	18 th and M Streets, NW	022, 034	09/14/26	*			
37	27 th and Eye Streets, NW	022	09/09/26	*			
38	29 th and K Streets, NW	024	09/03/26	*			
38a	30 th Street, south of K Street, NW	024	09/03/26	*			
39a	30 th and K Streets, NW	024	09/03/26	*			
39b	30 th and K Streets, NW	024	09/03/26	*			
41b ¹	31 st and K Streets, NW	025	N/A				
41c ¹	31 st and K Streets, NW	025	N/A				
42 ¹	Wisconsin Ave and K Street, NW	026	N/A				
43	Potomac and Water Streets, NW	027	09/03/26	*			
43a	Potomac and Water Streets, NW	027	09/03/26	*			
44	Water Street, west of Potomac St, NW	027	09/03/26	*			
45	36 th and M Streets, NW	028	09/16/26	*			
46	Canal Rd, 1000ft. east of Foxhall Rd, NW	029	09/16/26	*			
47	38 th Street and Reservoir Road, NW	029	09/16/26	*			
47a	37 th and T Streets, NW	029	09/16/26	*			
47b	37 th and T Streets, NW	029	09/16/26	*			
47c	38 th and W Streets, NW	029	09/16/26	*			
49 ¹	Pennsylvania Ave, east side of Rock Creek, NW	031	N/A				
50	26 and M Streets, NW	032	09/30/26	*			
51	N Street Extended, west of 25 th Street, NW	033	09/30/26	*			
52	22 nd Street between M and N Streets, NW	034	09/24/26	*			
52a	N Street between 22 nd and 23 rd Streets, NW	034	09/14/26	*			
53	22 nd and M Streets, NW	022, 034	09/14/26	*			
53a	22 nd and M Streets, NW	022, 034	09/14/26	*			
53b	L Street between 21 st Street and New Hampshire Ave, NW	022, 034	09/14/26	*			
53c	L and 22 nd Streets, NW	022	09/14/26	*			
54	23 rd and O Streets, NW	034	09/10/26	*			
55	22 nd Street, south of Q Street, NW	035	09/10/26	*			
55a	22 nd Street, south of Q Street, NW	035	09/10/26	*			

Structure Number	Location	Associated NPDES Outfall	Date Inspected	Condition		Work Needed	Work performed
				Good	Needs Work		
56	23 rd and Massachusetts Ave, NW	036	09/10/26	*			
57	23 rd Street, south of Q Street, NW	036	09/10/26	*			
58 ¹	Northwest of Belmont Road and Rock Creek and Potomac Parkway, NW	037	N/A				
59	North of Belmont Rd, east of Kalorama Cir, NW	038	09/16/26	*			
60	Connecticut Ave, east of Rock Creek, NW	039	09/16/26	*			
61	Biltmore St, Extended, east of Rock Creek, NW	040	09/16/26	*			
62	Ontario Rd, Extended, and Rock Creek Pkwy, NW	041	09/15/26	*			
63	Harvard Street and Rock Creek Parkway, NW	042	09/15/26	*			
64	Adams Mill Road, south of Irving Street, NW	043	09/15/26	*			
65	Kenyon Street and Adams Mill Road, NW	044	09/15/26	*			
65a	Kenyon Street and Adams Mill Road, NW	044	09/15/26	*			
66	Adams Mill Road and Lamont Street, NW	045	09/15/26	*			
67	Park Rd , south of Piney Branch Pkwy, NW	046	09/15/26	*			
68	Ingleside Terrance, Extended and Piney Branch Parkway, NW	047	09/15/26	*			
69	Mt. Pleasant Street, Extended and Piney Branch Parkway, NW	048	09/15/26	*			
70	Piney Branch Parkway, west of 16 th Street, NW	049	09/15/26	*			
70i	5 th and Quackenbos Streets, NW	049	09/15/26	*			
71	28 th Street, west of Rock Creek Parkway, NW	050	09/28/26	*			
72	Olive Street Extended and Rock Creek Pkwy, NW	051	09/10/26	*			
72a	Olive Street Extended and Rock Creek Pkwy, NW	051	09/10/26	*			
73	O Street Extended and Rock Creek Parkway, NW	052	09/28/26	*			
74 ¹	Q Street, west of Rock Creek, NW	053	N/A				
75	West side of Rock Creek, 300 ft. south of Massachusetts Ave, NW	054	09/22/26	*			
77	Normanstone Dr Extended, west of Rock Creek, NW	056	09/22/26	*			
77a	Normanstone Dr and Normanstone Lane, NW	056	09/22/26	*			
78 ¹	28th Street Extended, west of Rock Creek, NW	057	N/A				
79 ¹	Connecticut Ave and Rock Creek Parkway, NW	058	N/A				
84	26 th and P Streets, NW	060	09/10/26	*			
84a	26 th and P Streets, NW	060	09/10/26	*			
86	Diversion Chamber and Vortex Drop at First and Channing St, NW (First St Tunnel)	019	09/23/26	*			
88	Flagler and Adams St. NW (First St Tunnel)	019	09/23/26	*			
89	First and V St, NW (First St Tunnel)	019	09/23/26	*			

Structure Number	Location	Associated NPDES Outfall	Date Inspected	Condition		Work Needed	Work performed
				Good	Needs Work		
90	First and V St, NW (First St Tunnel)	019	09/23/26	*			
91	First and V St, NW (First St Tunnel)	019	09/23/26	*			
92	CSO 019 Diversion Near Eastside PS (Anacostia River Tunnel)	019	09/29/26	*			
93	CSO 018 Diversion Near Barney Circle (Anacostia River Tunnel)	018	09/29/26	*			
95	M Street Approach Channel M and Water St SE (Anacostia River Tunnel)	015, 016, 017	09/21/26	*			
96	CSO 007 Shaft at 11 th St Bridge and DC I-295 SB Diversion Facilities (Anacostia River Tunnel)	007	09/25/26	*			
97	CSO 005 Diversion at Chicago St Trunk Sewer, I295 SB (Anacostia River Tunnel)	005	09/25/26	*			
98	Main Pumping Station Diversions (Anacostia River Tunnel)	009 – 012	09/08/26	*			
99	CSO 009 and 011a Diversion Facilities (Anacostia River Tunnel)	009, 011a	09/29/26	*			
100	CSO 012 Diversion Facilities (Anacostia River Tunnel)	012	09/30/26	*			
101	Main Outfall Sewer Diversion Chamber (Anacostia River Tunnel)	N/A	09/08/26	*			
102	Anacostia Main Interceptor Diversion Chamber	N/A	09/08/26	*			
103	Poplar Point PS Emergency Overflow Chamber (Anacostia River Tunnel)	N/A	09/08/26	*			
104	Poplar Point PS Discharge Chamber	N/A	09/08/26	*			
105	Potomac Outfall Sewer Diversion Chamber (Anacostia River Tunnel)	003A	09/08/26	*			
106	R Street Diversion Chamber (RS-DC) and R Street Drop Shaft (RS-DS)	019	09/23/26	*			
107	Florida Avenue Diversion Chamber (FLA-DC), Florida Avenue Drop Shaft (FLA-DS)	019	09/23/26	*			
108	T Street Junction Chamber (TS-JC), T Street Drop Shaft (TS-DS)	019	09/23/26	*			
109	4th Street NE Diversion Chamber (4S-DC), 4th Street Drop Shaft (4S-DS)	019	09/23/26	*			
110	Rhode Island Avenue Diversion Chamber (RIA-DC), Rhode Island Avenue Drop Shaft (RIA-DS)	019	09/23/26	*			
111a	Mount Olivet Road Junction Chamber (MOR-JC)	019	09/23/26	*			
111b	Mount Olivet Road Diversion Chamber (MOR-DC)	019	09/23/26	*			
111c	Mount Olivet Road Drop Shaft (MOR-DS)	019	09/23/26	*			

Notes:

1. Noted structures no longer function as a combined sewer overflow regulator structure.

2.2 Outfalls, Tide Gates and CSO Signs

The following table summarizes inspections, maintenance and work performed on outfall structures, tide gates and CSO signs in the collection system.

Table 2-2
Outfalls and Tide Gates

NPDES Outfall	Location	Date Inspected	Outfall Condition		Tide Gate Present?		Tide Gate Condition		CSO Sign		Notes, Work Needed or Performed
			OK	Needs Work	Yes	No	OK	Needs Work	OK	Needs Work	
003 ¹	Bolling Air Force Base, at Giavanolli and Chanute, SW	N/A									
003a	Joint Base Anacostia Bolling Macdill and Arnold Ave SW	09/08/26	*		*		*		*		
005	Across from Navy Yard, aligned with Parsons Ave., SE	09/08/26	*		*		*		*		
006 ¹	Good Hope Road and Welsh Memorial Bridge	N/A									
007	Between 11 th St. and Anacostia Bridges, SE	09/08/26	*		*		*		*		
009	O St. Sewage Pumping Station, SE	09/28/26	*		*		*		*		
010	O St. Sewage Pumping Station, SE	09/28/26	*			*			*		
011	Main Sewage Pumping Station, SE	09/28/26	*			*			*		
011a	Main Sewage Pumping Station, SE	09/28/26	*		*		*		*		
012	Main Sewage Pumping Station, SE	09/28/26	*		*		*		*		
013	Southeast Federal Center, aligned with 4 th St.	09/28/26	*		*		*		*		
014	Navy Yard, aligned with 6 th St., SE	09/28/26	*		*		*		*		
015	Navy Yard, aligned with 9th Street, SE	09/28/26	*			*			*		
016	12th and O Streets, SE	09/28/26	*		*		*		*		
017	M and Water Street, SE	09/28/26	*		*		*		*		
018	East of Barney Circle & South of Pennsylvania Avenue Bridge, SE	09/26/26	*		*		*		*		
019	Adjacent to Service Drive behind swirl facility & D.C. General Hospital	09/29/26	*		*		*		*		
019a	Adjacent to Service Drive behind swirl facility & D.C. General Hospital (Tunnel Overflow Structure)	09/29/26	*		*		*		*		
020	Rock Creek Parkway and Independence, NW	09/03/26	*		*		*		*		
021	Rock Creek Parkway and C St., NW	09/03/26	*		*		*		*		
022	Rock Creek Parkway and G St., NW	09/03/26	*		*		*		*		
024	South of 30 th and K Streets, NW	09/03/26	*		*		*		*		
025 ¹	South of 31st and K Streets, NW	N/A									
026 ¹	Wisconsin Avenue and Water Street, NW	N/A									
027	33 rd and Water Sts., NW	09/03/26	*			*			*		
028	Key Bridge and Whitehurst Freeway, NW	09/03/26	*			*			*		
029	Adjacent to C&O Canal, aligned with 38 th St. NW	09/03/26	*			*			*		

NPDES Outfall	Location	Date Inspected	Outfall Condition		Tide Gate Present?		Tide Gate Condition		CSO Sign		Notes, Work Needed or Performed
			OK	Needs Work	Yes	No	OK	Needs Work	OK	Needs Work	
031 ¹	Rock Creek Pkwy & Pennsylvania Avenue, NW	N/A									
032	26th and M Street, NW	09/30/26	*			*			*		
033	Across street from St. Francis Jr. High and aligned with N St., NW.	09/30/26	*		*		*		*		
034	Just west of St. Francis Jr. High and north of N St., NW	09/10/26	*			*			*		
035	P St. Bridge and Rock Creek Parkway	09/10/26	*			*			*		
036	22nd Street, South of Q Street NW.	09/22/26	*		*		*		*		
037 ¹	Waterside Dr. and Rock Creek Parkway	N/A									
038	Between arch footbridge and Connecticut Ave., north of Kalorama Circle, NW.	09/16/26	*		*		*		*		
039	Connecticut Avenue Bridge and Rock Creek Parkway, NW.	09/16/26	*		*		*		*		
040	Aligned with Biltmore Rd., between Connecticut Ave and Ellington Bridge.	09/16/26	*		*		*		*		
041	Beach Dr. and Ontario Pl., NW	09/14/26	*		*		*		*		
042	Harvard St. and Beach Dr NW.	09/14/26	*		*		*		*		
043	Upstream of Harvard St. and Beach Dr NW.	09/14/26	*		*		*		*		
044	Kenyon Street and Beach Dr., NW.	09/14/26	*		*		*		*		
045	North of Beach Dr. and Walbridge Pl, NW.	09/14/26	*		*		*		*		
046	Piney Branch Parkway and Park Road, NW.	09/15/26	*			*			*		
047	Piney Branch Parkway and Ingleside Terrace	09/15/26	*		*		*		*		
048	South of Piney Branch Parkway and 17 th St.	09/15/26	*		*		*		*		
049	North of Piney Branch Parkway and 17 th St.	09/15/26	*		*		*		*		
050	Rock Creek Parkway and L St., NW	09/22/26	*		*		*		*		
051	Across Rock Creek Pkwy, aligned with Olive St., NW.	09/28/26	*		*		*		*		
052	Between P & Penna. Ave Bridges, aligned with O Street, NW.	09/28/26	*		*		*		*		
053 ¹	Q St. Bridge and Rock Creek Parkway, NW.	N/A									
054	Massachusetts Ave & Rock Creek Parkway, NW.	09/22/26	*		*		*		*		
056	Normanstone Dr. and Rock Creek Parkway, NW.	09/22/26	*		*		*		*		
057 ¹	28th Street and Rock Creek Parkway, NW	N/A									
058 ¹	Connecticut Ave & Rock Creek Parkway, NW.	N/A									
060	North of P St. Bridge & Rock Creek Pkwy, NW	09/22/26	*		*		*		*		

Notes:

1. Outfall no longer functions as a combined sewer outfall.

Pumping Stations

Pumping station operations are summarized in the table below.

Table 2-3
Pumping Stations – Inspections and Equipment in Service

<i>Pumping Station</i>	<i>No. of Inspections</i>	<i>No. Screens</i>	<i>No. Pumps</i>	<i>Screens or Pumps Out of Service</i>	<i>Dates</i>	<i>Reason</i>	<i>Work Order Number</i>	<i>Schedule to Restore to Service</i>
Main	30	3	4	Screen 4 ³	09/01/26-09/30/26	Screen motor failure	26-368268	Anticipated return to service 10/31/26
O Street	30	2	4	Screen 2	09/01/26-09/30/26	High motor alarm	26-29851	Anticipated return to service 10/31/26
				Pump 4 ²	09/01/26-09/30/26	Actuator needs to be replaced	26-120944	Anticipated return to service 10/31/26
Eastside	1	2	4	None	-	-	-	-
Poplar Point	1	2	4	None	-	-	-	-
Potomac	30	4	5	Pump 1 ¹	09/01/26-09/30/26	Motor needs repair	25-579179	Anticipated return to service 02/28/27

Notes:

1. Manufacturer parts aren't readily available, so we continue to wait for replacement parts to be built and delivered. Upgrade CIP project underway to replace with new equipment.
2. Contractors working underground, actuator will be replaced once work is completed
3. Manufacturer parts aren't readily available, so we continue to wait for replacement parts to be delivered.

Table 2-4
Pumping Stations – Preventive Maintenance

<i>Pumping Station</i>	<i>Date Performed</i>	<i>Type of Preventive Maintenance Performed¹</i>	<i>Work Order Number</i>	<i>Comments</i>
Main	09/04/26	Group A	26-736811	Add oil, grease bearings and replace packing if needed.
O St	09/04/26	Group A	26-748411	Add oil, grease bearings and replace packing if needed.
Eastside	09/21/26	Group A	26-685642	Add oil, grease bearings and replace packing if needed.
Poplar Point	09/21/26	Group A	26-739462	Add oil, grease bearings and replace packing if needed.
Potomac	09/04/26	Group A	26-751099	Add oil, grease bearings and replace packing if needed.
Rock Creek	09/21/26	Group A	26-727927	Add oil, grease bearings and replace packing if needed.
Upper Anacostia	09/21/26	Group A	26-739498	Add oil, grease bearings and replace packing if needed.
Earl Place	09/21/26	Group A	26-706091	Add oil, grease bearings and replace packing if needed.

Notes:

1. Group A consists of:
 - a. Exercise bar screens
 - b. Exercise all sump pumps
 - c. Drain condensation from air compressor storage tank
 - d. Check depth of screening in the screen room and schedule Vactor truck as required
 - e. Check all safety equipment
 - f. Issue work order requests as required

Table 2-5
Pumping Stations – Pumpage

	<i>Sanitary Pumpage</i>		<i>Screenings Collected (tons)¹</i>
<i>Pumping Station</i>	<i>Total Wastewater (mg)</i>	<i>Daily Average Wastewater (mg)</i>	
Main ^{1,2}	1044.81	34.83	N/A
O St ^{1,2}	154.95	5.17	N/A
Eastside	114.56	3.82	N/A
Poplar Point	274.03	9.13	N/A
Potomac	3117.93	103.93	N/A
Rock Creek ³	39.95**	1.33**	N/A
Upper Anacostia	29.228	0.974	N/A
Earl Place	0.1044	0.00348	N/A

Notes:

1. Screenings collected from the Main and O Street Pumping Stations are combined from the sanitary flow and combined sewer overflows, due to the design of the screening system that consists of vertical trash racks, with no mechanical cleaning. Therefore, quantification of captured screening materials, specifically from combined sewer overflows, is not feasible.
2. Flow meters have been installed in accordance with NPDES Permit No. DC002199 to record CSO discharges from Main and O Street Pumping Stations. This data is reported via Discharge Monitoring Reports submitted to the EPA on a monthly basis. A summary of metered and modeled CSO discharges is included in Section 5.
3. In April 2025, instrumentation began work to replace the flow meter on Pump #2 at Rock Creek PS. Replacement will occur once the flow meter supplier is able to send out new equipment. See WO# 25-385565 **Values above are directly from SCADA software

2.3 Inflatable Dams and SCADA System

DC Water operates and maintains nine inflatable dams at seven different locations. Table 2-6 summarizes the date(s) the inflatable dams were inspected, and their operational status and condition. The inflatable dams consist of multi-ply elastomeric (i.e., “rubber”) fabric dams installed in major overflow conduits within the combined sewer system. The objective of the inflatable dam installation is to increase the effective depth to which the sewage must rise in the combined sewer before overflows occur. The effect of the installation is to retain a greater volume of combined sewage flow resulting from low to moderate intensity storms by maximizing storage within the CSS. During higher intensity storms, when the full carrying capacity of the overflow conduit is required to prevent upstream flooding, the dam is deflated automatically. Inflatable dam operations are summarized below:

Table 2-6
Inflatable Dams – Inspections and Equipment in Service

<i>Inflatable Dam Structure No</i>	<i>Date Inspected</i>	<i>Was Dam Out of Service During the Month?</i>	<i>Dates out of Service</i>	<i>Reason</i>	<i>Schedule to Restore to Service</i>
14 – East	9/24/26	No	N/A	N/A	N/A
14 – West	9/24/26	No	N/A	N/A	N/A
15	9/4/26	Yes	9/4/26	Note 1	9/4/26
	9/24/26	No	N/A	N/A	N/A
15A	9/24/26	No	N/A	N/A	N/A
16 – East	9/29/26	No	N/A	N/A	N/A
16 – West	9/29/26	No	N/A	N/A	N/A
34	9/24/26	No	N/A	N/A	N/A
35	9/28/26	Yes	9/28/26	Note 2	9/28/26
	9/29/26	No	N/A	N/A	N/A
52	9/29/26	No	N/A	N/A	N/A

Notes:

1. Structure 15 deflated on 9/4/26 around 12:42am due to a blower motor failure. Instrumentation was notified and the structure was returned to service within six hours. See WO#26-733149. This deflation occurred during a wet weather overflow event. See Table 2-7.
2. Structure 35 deflated on 9/28/26 around 2:50am due to a loss of communication with the structure. The structure was reinflated and returned to service within seventeen minutes. This was not an overflow to the river as the upstream levels were lower than the low-level threshold.

Table 2-7
Inflatable Dams & SCADA Sites – Wet Weather Operations

<i>Inflatable Dam Structure No.</i>	<i>Overflow Dates</i>	<i>Estimated Duration of Overflow</i>	<i>Inflatable Dam Operational Status</i>
14 (E & W)	<i>None</i>	<i>N/A</i>	<i>Inflated</i>
15	<i>9/4/26</i>	<i>3hrs 5mins</i>	<i>Deflated</i>
15A	<i>None</i>	<i>N/A</i>	<i>Inflated</i>
16 (E & W)	<i>None</i>	<i>N/A</i>	<i>Inflated</i>
34	<i>None</i>	<i>N/A</i>	<i>Inflated</i>
35	<i>9/11/26</i>	<i>47mins</i>	<i>Deflated</i>
52	<i>None</i>	<i>N/A</i>	<i>Inflated</i>
<i>Structures on Outfall Sewers</i>	<i>Overflow Dates</i>	<i>Estimated Duration of Overflow</i>	<i>N/A</i>
Outfall Structure 1	None	This structure has been bulk headed. Overflows are no longer possible.	
Outfall Structure 1A	None	This structure has been bulk headed. Overflows are no longer possible.	
Outfall Structure 2	None	N/A	
<i>Outfall Sewer Control Gates</i>	<i>Operational Status</i>	<i>Position</i>	
Outfall Sewer Control Gate No.1	Operational	Open	
Outfall Sewer Control Gate No.2	Operational	This structure has been bulk headed. Overflows are no longer possible	
Outfall Sewer Control Gate No.2	Operational	This structure has been bulk headed. Overflows are no longer possible	

Notes:

3. DRY WEATHER OVERFLOWS

There was no dry weather combined sewer overflow reported during September 2026.

4. SOLIDS AND FLOATABLES CONTROL

4.1 Catch Basin Cleaning

The following tables summarize catch basin cleaning in the Anacostia CSO area and in the entire sewer system:

**Table 4-1
Catch Basin Cleaning**

Ward	Total CBs	CBs in CSS	Inspections			Cleaning					
			CBs in Anacostia CSS	Total Anacostia CBs Inspected Once this Year	Total Anacostia CBs Inspected Twice this Year	CBs Cleaned Thru Last Month		CB's Cleaned This Month		Total CBs Cleaned This Year to Date	
						Total	In CSS	Total	In CSS	Total	In CSS
1	1467	1442	655	543	264	608	591	284	284	892	875
2	2832	2647	486	450	68	829	721	908	908	1737	1629
3	3720	183	0	0	0	3618	155	21	21	3639	176
4	3521	1729	0	0	0	3348	1674	9	8	3357	1682
5	4066	1758	1693	1104	84	2474	137	16	13	2490	150
6	3333	2692	2676	2248	201	892	249	24	17	916	266
7	3879	43	43	43	0	3638	3	8	0	3646	3
8	2930	213	212	7	0	1841	7	3	0	1844	7
Grand Total	25748¹	10707¹	5765¹	4395	617	17248	3537	1273	1251	18521	4788
% Cleaned/Inspected to Date				76%	11%					72%	45%

Notes:

1. The number of catch basins in our service area changes with the ongoing connections and abandonments to the sewer infrastructure.

4.2 BMP Demonstration for Solid and Floatable Control

DC WATER operates the following demonstration projects designed to remove solids and floatables from CSO prior to discharge.

- Bar Rack at CSO 040 and 041 to Rock Creek

Table 4-2
BMP Demonstration Projects – Report

<i>Facility</i>	<i>Date Inspected</i>	<i>Condition</i>	<i>Work Needed</i>	<i>Work performed</i>	<i>Material Removed (LB)</i>
Bar Rack CSO 040	9/20/26	Good	None	Routine Cleaning	(1)
Bar Rack CSO 041	9/21/26	Good	None	Routine Cleaning	(1)

Notes:

(1) System was designed so that captured solids and floatables are conveyed to Blue Plains for treatment.

4.3 Anacostia River Floating Debris Removal Program

This program was initiated in October 1992 to remove floating debris from Anacostia and Potomac Rivers on a routine basis. The program has continued from that time and is now under the auspices of DC WATER, Department of Sewer Operations. The floating debris removal program utilizes a skimmer boat and support boats to remove floatable debris from the Rivers as well as trash, which accumulates on the riverbanks and in the mud flats at low tides. Work for the most part is directed toward the Anacostia River. The boats pick up debris five days a week. Operations are summarized as follows:

Table 4-3
Anacostia River Floating Debris Removal Program – Summary

<i>Program Operation</i>	5-day work week, excluding holidays, weather permitting
<i>Work Days this month:</i>	21
<i>Days not Operating</i>	6
<i>Reason not Operating</i>	Maintenance, wind, low water levels.
<i># Skimmer in Fleet</i>	3 Skimmers
<i># Skimmers Out of Service</i>	2 Skimmer
<i>Dates</i>	B34: September 1 - September 30. B37: September 1 – September 09
<i>Reason</i>	B34: No. 1 screen off track. B37: Broken weld on starboard wing
<i>Plan to Restore to Service</i>	B34: ETR December 2026. B37: Returned to operation on Sep 10.
<i>Amount Material Collected</i>	2 tons this month. Calendar year to date 23 tons.
<i>Nature of Material</i>	Bottles, cans. natural debris, and plastics.

4.4 CSS Litter Control

This section describes DC WATER's efforts to coordinate litter control efforts with the National Park Service and D.C. Department of Public Works to maximize litter control efforts in the combined sewer system.

No Activity this month.

5. MONITORING

5.1 Condition Report Bar Racks at Main and O Street Storm Pumps

DC Water performs visual surveys of the bar racks at Main and O Street Pumping Stations to characterize the quantity and nature of floatable discharge. The physical condition of the bar racks and any maintenance requirements are also noted.

Table 5-1
Bar Racks at Main & O Street Pumping Stations

Pumping Station	Date Inspected	Condition		Work Order Number	Work Needed	Work Performed or Schedule for Completion
		Good	Needs Work			
Bar Racks at O Street Storm Pumps (CSO 010)	9/04/26	X		26-761811		
Bar Racks at Main Storm Pumps (CSO 011)	9/04/26	X		26-761804		

5.2 Rain Data

Rain data from National Airport and from the rain gauges installed in the CSS are summarized below.

Date	Brentwood Pumping Station	Bryant Street Pumping Station	Main Pumping Station	Rock Creek Pumping Station	National Airport
9/1/2026	0	0	0	0	0
9/2/2026	0.01	0.04	0.32	0.28	0.33
9/3/2026	0.46	0.32	0.99	0.66	1.25
9/4/2026	0.44	0.17	0.45	0.27	0
9/5/2026	0	0	0	0	0
9/6/2026	0	0	0	0	0
9/7/2026	0	0	0	0	0
9/8/2026	0	0	0	0	0
9/9/2026	0	0	0	0	0
9/10/2026	0	0	0	0	0
9/11/2026	0.63	0.43	0.71	0.64	0.68
9/12/2026	0	0	0	0	0
9/13/2026	0.01	0	0.01	0.09	0.02
9/14/2026	0	0	0	0	0
9/15/2026	0	0	0	0	0
9/16/2026	0	0	0	0	0
9/17/2026	0.12	0.09	0.01	0	0
9/18/2026	0	0	0	0	0
9/19/2026	0	0	0	0	0
9/20/2026	0.01	0.09	0	0.01	0
9/21/2026	0.24	0.13	0.27	0.29	0.43
9/22/2026	0.93	0.75	1.13	1.10	0.81
9/23/2026	0.29	0.27	0.51	0.34	0.40
9/24/2026	0	0	0	0	0
9/25/2026	0	0	0	0	0
9/26/2026	0.31	0.19	0.36	0.28	0.30
9/27/2026	0.05	0.04	0.07	0.03	0.04
9/28/2026	0	0	0	0	0
9/29/2026	0	0	0	0	0
9/30/2026	0	0	0	0	0
TOTAL	3.50	2.52	4.83	3.99	4.26

5.3 Wet Weather Overflows

The wet weather overflow data for this quarter is reported below in the Combined Sewer System Modeled and Metered Quarterly Results table located in Section 5.3 of the September 2026 Report.

District of Columbia Water and Sewer Authority

Combined Sewer System Metered and Model Results

Period: Q2 2026 (July, August, September)

SCENARIO: QuarterlyReport_2026Q3_ALL, produced on 5 October 2026

NPDES No.	Description	Data Source	Number of Overflows (Occurrences)	CSO Overflow Volume (mg)	Total Duration of Overflow (hrs)	Avg Duration of Overflow (hrs)	Maximum Duration of Overflow (hrs)	Minimum Duration of Overflow (hrs)
Anacostia CSOs								
005	Chicago St and Railroad Station SE	Modeled	0	0.00	0.00	0.00	0.00	0.00
006	Good Hope Road, West of Nichols Ave., SE	separated						
007	13 th Street and Ridge Place, SE	Metered	0	0.00	0.00	0.00	0.00	0.00
009	2nd Street, 300 feet North of N Place, SE	Metered	0	0.00	0.00	0.00	0.00	0.00
010	O Street Sewage Pumping Station, SE (pumped Overflow)	Metered	1	5.54	3.08	3.08	3.08	3.08
011	South of Main Sewage Pumping Station, SE (pumped overflow)	Metered	0	0.00	0.00	0.00	0.00	0.00
011a	South of Main Sewage Pumping Station, SE (gravity overflow)	Metered	0	0.00	0.00	0.00	0.00	0.00
012	North of Main Sewage Pumping Station, SE (Tiber Creek)	Metered	0	0.00	0.00	0.00	0.00	0.00
013	4th and N Streets, SE	Modeled	0	0.00	0.00	0.00	0.00	0.00
014	6th and M Streets, SE	Modeled	0	0.00	0.00	0.00	0.00	0.00
015	9th and M Streets, SE	consolidated to tunnel system						
016	12th and M Streets, SE	consolidated to tunnel system						
017	14th and M Streets, SE	consolidated to tunnel system						
018	Barney Circle and Pennsylvania Ave, SE	consolidated to tunnel system						
019	Northeast Boundary	Metered	0	0.00	0.00	0.00	0.00	0.00
019A	Northeast Boundary - Tunnel OF	Metered	0	0.00	0.00	0.00	0.00	0.00
	SUBTOTAL			5.54				
Potomac CSOs								
003A	JBAB Tunnel OF	Metered	0	0.00	0.00	0.00	0.00	0.00
020	23rd Street, North of Constitution Ave, NW (Easby Point)	Modeled	10	17.23	14.75	1.48	6.00	0.25
021	Northeast of Roosevelt Bridge, NW	Modeled	10	93.66	16.25	1.63	6.50	0.25
022	27th and K Streets, NW	Modeled	16	3.96	37.25	2.33	13.25	0.25
024	30th and K Streets, NW	Modeled	18	6.20	56.25	3.13	14.75	0.25
025	31st & K St NW	separated						
026	Wisconsin Avenue and K St., NW	separated						
027	Water Street West of Street, NW	Modeled	14	7.48	35.00	2.50	15.25	0.25
028	36th and M Streets, NW	Modeled	16	3.10	69.00	4.31	37.75	0.75
029	Canal Road 1000 feet east of Rock Creek, NW	Modeled	16	6.20	39.00	2.44	19.00	0.25
	SUBTOTAL			137.83				
Rock Creek								
031	Pennsylvania Avenue, East Rock Creek, NW	separated						
032	26th and M Streets, NW	Modeled	0	0.00	0.00	0.00	0.00	0.00
033	N Street extended west of 25th Street, NW	Modeled	0	0.00	0.00	0.00	0.00	0.00
034	23rd and O Streets, SW	Modeled	0	0.00	0.00	0.00	0.00	0.00
035	22nd Street south of Q Street, NW	Modeled	0	0.00	0.00	0.00	0.00	0.00
036	22nd Street South of Q Street, NW	Modeled	12	0.39	16.25	1.35	6.00	0.50
037	Northwest of Belmont and Rock Creek and Potomac Parkway	separated						
038	North of Belmont Road, east of Kalorama Circle, NW	Modeled	1	0.0001	0.25	0.25	0.25	0.25
039	Connecticut Avenue east of Rock Creek, NW	Modeled	1	0.02	0.25	0.25	0.25	0.25
040	Biltmore Street extended east of Rock Creek, NW	Modeled	0	0.00	0.00	0.00	0.00	0.00
041	Ontario extended and Rock Creek Parkway	Modeled	0	0.00	0.00	0.00	0.00	0.00
042	Harvard Street and Rock Creek Parkway, NW	Modeled	3	0.19	0.75	0.25	0.25	0.25
043	Adams Mill Road South of Irving Street, NW	Modeled	4	0.86	4.25	1.06	3.25	0.25
044	Kenyon Street and Adams Mill Road, NW	Modeled	2	0.11	0.50	0.25	0.25	0.25
045	Adams Mill Road and Lamont Street, NW	Modeled	4	0.16	1.00	0.25	0.25	0.25
046	Park Road south of Piney Branch Parkway, NW	Modeled	4	0.05	1.00	0.25	0.25	0.25
047	Ingleside Terrace extended and Piney Branch Parkway	Modeled	2	0.01	0.50	0.25	0.25	0.25
048	Mt. Pleasant Street extended and Piney Branch Parkway	Modeled	4	0.27	1.00	0.25	0.25	0.25
049	Piney Branch and Lamont Street, NW	Modeled	4	9.19	5.25	1.31	3.75	0.25
050	28th Street west of 16th Street, NW	Modeled	0	0.00	0.00	0.00	0.00	0.00
051	Olive Street extended and Rock Creek Parkway, NW	Modeled	0	0.00	0.00	0.00	0.00	0.00
052	O Street extended and Rock Creek Parkway, NW	Modeled	0	0.00	0.00	0.00	0.00	0.00
053	O Street west of Rock Creek Parkway, NW	separated						
054	West Side of Rock Creek 300 ft. south of Mass. Ave, NW	Modeled	0	0.00	0.00	0.00	0.00	0.00
056	Normanstone Drive extended west of Rock Creek, NW	Modeled	0	0.00	0.00	0.00	0.00	0.00
057	28th Street extended west of Rock Creek, NW	separated						
058	Connecticut Avenue and Rock Creek Parkway, NW	separated						
060	P St and 26 th St, NW	Modeled	0	0.00	0.00	0.00	0.00	0.00
	SUBTOTAL			11.24				
	TOTAL			154.61				

District of Columbia Water and Sewer Authority

Combined Sewer System Metered and Model Results
Period: Q2 2026 (July, August, September)

SCENARIO: QuarterlyReport_2026Q3_ALL, produced on 5 October 2026

NPDES No.	Description	Data Source	Number of Overflows (Occurrences)	CSO Overflow Volume (mg)	Total Duration of Overflow (hrs)	Avg Duration of Overflow (hrs)	Maximum Duration of Overflow (hrs)	Minimum Duration of Overflow (hrs)
-----------	-------------	-------------	---	--------------------------------	---	--------------------------------------	---	---

C:\Users\mbennett\AppData\Local\Microsoft\Oik\Attachments\00a-d3816f84-ed40-4fbb-9199-75890a66db6e\8a78b52d083b2951a2401f88a2c9131ff4301d96cb2d7

Prepared by: Greeley and Hansen LLC and Limno-Tech, Inc.